MAY 1 6 1997

MARCH	MSSION
-------	--------

## LAND CORNER RECORDATION CERTIFICATE

F	or corners in Lake	Filing Require	ement of Act 74, Mich. P.A.	. 1970	RECISTER	EP 12	AKE
	(County)	Located In:	Corner Code ##		3151	•	000
1.	Public Land Survey	T 19N R 13W T 19N R 14W T R	A-4 V	*	R OF DEEDS	3 10 PH 1	UNTY, MI
2. 3.	in Section	T R S T R S T R S T R	tiber 0 0 3	3 PAGE () 36 ( Register of C	#	np & File I	Number
4.		Recorded Plat					
5.	Private Claims	icoorded Flat		А В	CDE	FGH:	JKLA
				2	54	3	
L	Robert L. Wetherell	in a field surveyor	June 5, 96	3	8 9	)——10—	-1112
cu Ma ab Co	rrent manual of survey instru nagement or by a decree of a ove were in conformance wit	, in a field survey on	d rules therefore as required in the ment of the Interior, Bureau of Lan ripoints mentioned in lines 3, 4 and It and Surveyors or by a Decree of	nd 7 18 19 19 19 19 19 19 19 19 19 19 19 19 19	20 -21	122	1413
NC	OTE: Not more than 4 co on this certificate.	orners, all in the same town and	d range, may be recorded	11 12 31	32 -33		35 36-
Α.	Description of original r	monument and accessories and	/or subsequent restoration:	13	<del>      </del>		<u> </u>
	A-4 & M-4 - 1/4 Corner	common to Sec. 7, T19N R13W and	d Sec. 12, T19N, R14W, Lake C	Co., Mi.			

1837 - Mullett & Brookfield, G.L.O.

#1 - 12" Y. Pine \$67°W 73 Links

#2 - 7" Y. Pine N24<sup>0</sup>W 25 Links

1920 - George Johnson, Co. Sur.

#3 - 7" B. Oak S41<sup>0</sup>30'E 51.0'

1979 - Robert L. Wetherell, LS 24624

Set 1/2 capped re-bar by single proportionate

method (2597.65' each direction)

#4 - 8" W. Oak S86<sup>O</sup>W 90.08'

#5 - 10" W. Oak N27°W 52.54'

#6 - 10" B. Oak East 68.77'

Corner is 22' West of centerline of

North and South road

1981 - Robert L. Griffin, LS 13584 Replaced 1/2" iron with standard

U.S.F.S Concrete Monument

#5 - 10" W. Oak N270W 52.54' #6 - 10" B. Oak East 68,771

#7 - 8" B. Oak N60°W 53.84'

B. Description of corner evidence found and/or method applied in restoring or recstablishing corner:

A-4 & M-4 - 1/4 Corner common to Sec. 7, T19N R13W and Sec. 12, T19N, R14W, Lake Co., Mi.

I found U.S.F.S. Monument badly damaged by Lake County Road Commission road grader, (Lake County Road Commission informed me in 1994 that they had hit the monument). I reset the corner from found accessories No. 5, No. 6 and No. 7 above. Corner is 22 feet West of centerline of North and South road. Condition of the accessories are as follows: #1. Gone, #2. Gone,

FATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH 24, 345 CHAIRMAN 2 L. DATE 8-27-96

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

#3 Gone, #4 Found in good condition, #5. Found in good condition, #6. Found stump, #7. Dead.

A-4 & M-4 - 1/4 Corner common to Sec. 7, T19N R13W and Sec. 12, T19N, R14W, Lake Co., Mi.

I set a 3/4" x 24" re-bar with Lake County Brass Cap, and is accepted as a careful and faithful re-establishment of the position of the original corner. AND THE PERSON NAMED IN

14" B. Oak N67°E 132.87' (60d spike in N. side)

 $8^{\text{H}}$  B. Oak \$580E 67.23' (60d spike in S. side)

10" W. Oak N250W 52.54' (found spike in E. side) #5

 $8\,^{\rm H}$  W. Oak  $\rm S83^{\rm O}W$  90.01' (60d spike in N. side) #4

Surveyor's Michigan License No.

September 6, 1996

WETHERELL LAND Surveyor NO.

STATE OF MICHO

ROBERT L

BEVISED-MAY 14, 1975