

MAR 16 2001

2000 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Newaygo (County)


Located in: Corner Code #

VOL. 3

65

- 1. Public Land Survey: T15 N R11 W, T N R W, T N R W, T N R W, T N R W, T N R W, T N R W, T N R W, T N R W, T N R W
- 2. Property Controlling in Section: S
- 3. Miscellaneous Property in Sec.: S

K-7

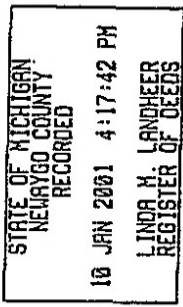

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Norman L. Ochs, in a field survey on August 9, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

Southeast Corner, Section 14, Norwich Township, Newaygo County, Michigan

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SEBSEQUENT RESTORATION:

- G.L.O. Milton Nye 1856 Resurvey
- 10" Beech N56°W 44 links (29.04') #1
- 15" Beech S56°E 32 links (21.12') #2
- William M. Jacques (County Surveyor)
- 1907 Book 4, Pages 37-40
- 20" Pine S50°E 45.0' #3

- County Surveyors Witness Book Page 46
- 24" Pine Stump S33°E 42.5' #3
- 40" Pine Stump N29°W 87.4' #4
- 6" Shrub Oak N64°W 100.0' #5

Measured 40.04 Chains (2642.64') from the Northeast Corner to the East One Quarter Corner and Measured 80.01 Chains (5280.66') to the Southeast Corner of Section 23

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

Found 5" square United States Forest Service concrete monument with 3" diameter brass disk. The centerline of an East and West bituminous road is 1.0' South. There is no apparent North or South occupation. The condition of the witnesses are as follows: #1 thru #4 gone, #5 thru #7 good condition, #8 gone, #9 thru #12 good condition.


C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

Placed a new 8" diameter cast iron monument box over the 5" square United States Forest Service concrete monument. Accepted the 5" square United States Forest Service concrete monument as a substantial marker for the section corner and as a careful and faithful reestablishment of the position of the original corner.

- 20"-24" Twin Black Oak S40°W 78.99' Found dock spike in NW side #6
- 8" Black Ash S12°E 48.27' Set spike with tag in E side
- 18" White Oak N12°W 70.74' Found spike in E side
- 4"-12"-12"-12" Quadruple Maple N65°E 101.95' Set spike with tag in S side

Signed by Norman L. Ochs
Norman L. Ochs

Date August 15, 2000

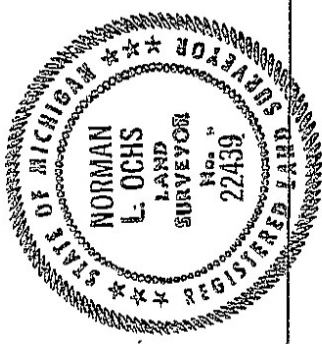

Surveyor's Michigan License No. 22439

Approved by Peer Review Group on 8/30/00
Norman L. Ochs, County Representative