

**SURVEY &
REMONUMENTATION**

MAR 13 2002

2001 Newaygo County Remonumentation Project

SECTION

For corners in
Newaygo
(County)


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Located in: Corner Code #

VOL. **3**

212

- Public Land Survey
T14 N R11 W
T N R W
T N R W
T N R W
T N R W
- Property Controlling
in Section S
S
S
S
- Miscellaneous
Property in Sec. S
S
S
S

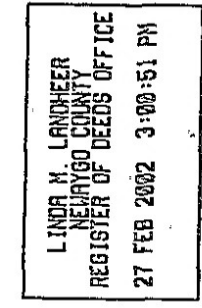

Register of Deeds Stamp & File Number

- Lot No. _____, Recorded Plat _____
- Private Claims _____

I, Norman L. Ochs, in a field survey on September 30, 20 01, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management, or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

Southwest Corner, Section 21, Goodwell Township, Newaygo County, Michigan

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

- G.L.O. John Mullett 1837
- #1 16" Pine N25°E 24 links (15.84')
- #2 18" Hemlock N33°W 14 links.(9.24')

- Delos G. Anderson, (County Surveyor)
- Book A, Page 221
- #3 24" Pine Stump S10°E 18 links (11.88')
- #1 18" Pine Stump N25°E 24 links (15.84')

OVER ↵

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I found a 5/8" x 22" Rod inside a 3/4" x 18" Iron Pipe on top of a 1 1/2" 28" solid Rod, also found broken glass and remnants of a wood stake in the hole. The corner is in the centerline of a North-South bituminous road and in the centerline of a gravel road to the West. The corner is 4' South of a two-track road East. The condition of the recorded witnesses are as follows:
#1 thru #5 gone, #6 good condition, #7 gone, #8 good condition, #9 gone, #10 thru #12 good condition.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I removed the 5/8" x 22" Rod inside a 3/4" x 18" Iron Pipe on top of a 1 1/2" 28" solid Rod and I set a 4" Harrison cast iron monument 20" long marked "County Surveyor #22439" in the exact location, grouted at surface, as a substantial marker for the section corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

- #8 Power Pole S58°E 72.23' Found P.K. in South side
- #10 Power Pole N65°E 63.48' Found P.K. in South side
- #11 18"-20" Twin White Oak N20°W 71.12' Reset 40d spike with tag in East side
- #12 20" Maple S25°W 74.45' Found spike in Northwest side



Signed by Norman L. Ochs Date October 1, 2001
Norman L. Ochs

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on October 9, 2001
Norman L. Ochs, County Representative.

N.L.O.