


**SURVEY &  
REMONUMENTATION**

AUG 10 2005



Liber **5** Page **321**

RECORDED  
LAKE COUNTY, MI  
18 OCT 2004 2:07:42 PM  
  
SHELLY MYERS  
REGISTER OF DEEDS

**SECTION**  
**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich., P.A. 1970

Far corners in \_\_\_\_\_ Located in: \_\_\_\_\_ Corner Code# \_\_\_\_\_  
 Lake \_\_\_\_\_  
 (County) \_\_\_\_\_

1. Public Land Survey \_\_\_\_\_  
     T18N R14W \_\_\_\_\_ E-8  
     T\_\_NR\_\_W \_\_\_\_\_  
     T\_\_NR\_\_W \_\_\_\_\_  
     T\_\_NR\_\_W \_\_\_\_\_  
     T\_\_NR\_\_W \_\_\_\_\_  
     T\_\_NR\_\_W \_\_\_\_\_  
     T\_\_NR\_\_W \_\_\_\_\_

2. Property Controlling \_\_\_\_\_  
 in Section \_\_\_\_\_

3. Miscellaneous \_\_\_\_\_  
 Property in Sec. \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Register of Deeds stamp & l

I, **Robert L. Wetherell**, in a field survey on August 3, 2004, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

E-8 ¼ Corner 20 & 21

**A. Description of original monument and accessories and/or subsequent restoration:**

- 1838 Sibley, G.L.O.**  
 #1. 16" Pine N64°W 12 Lks.  
 #2. 14" Hemlock S43°E 16 Lks.
- 1908 G. West, Co. Surveyor**  
 #3. 30" W. Pine stump N53°E 38 Lks.  
 #4. 9" Hemlock S64°W 41 ¾ Lks  
 #5. Distance North to Sec. Corner = 2673.66  
 #6. Distance South to Sec. Corner = 2673.66
- 1931 G. Johnson, Co. Surveyor**  
 #3. 30" W. Pine stump N55°-30'E 25.5'  
 #7. 6" Ironwood S44°-45'W 25.2'  
 #5. Distance North to Sec. Corner = 2660'
- 1940 H. Arnouts, U.S.F.S.**  
 "Bed rail"  
 #8. 4" Ironwood S81°E 64 Lks.  
 #9. 6" Ironwood S9°E 64 Lks.  
 #7. 6" Ironwood S45°W 38 Lks.  
 #10. 4" Ironwood N2°W 18 Lks.
- 1964 R. Griffin, L.S. 13584**  
 L.C.R.C. L.01, Pg. 103  
 Found bed rail - set 5" concrete monument  
 #3. W. Pine stump N53°E 26.3'  
 #11. 16" W. Oak S82°E 42.62'  
 #12. 4" W. Oak S21°E 48.95'  
 #9. 9" Ironwood S8°E 42.66'  
 #7. 7" Ironwood S45°W 25.03'  
 #10. 10" B. Oak N2°W 11.76'
- 1983 C. Cole, L.S. 17615**  
 Survey Record L.02, Pg. 473  
 Witness same as Griffin's (1964)  
 #5. Distance North = 2657.86'
- 1988 S. Barnett, L.S. 16923**  
 Found 5" Concrete monument  
 #5. Distance North to Sec. Corner = 2657.57  
 #6. Distance South to Sec. Corner = 2671.20'

A	B	C	D	E	F	G	H	I	J	K	L	M
1	2	3	4	5	6	7	8	9	10	11	12	13
1	2	3	4	5	6	7	8	9	10	11	12	13
14	15	16	17	18	19	20	21	22	23	24	25	26
27	28	29	30	31	32	33	34	35	36			

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found Griffin's 5" concrete monument on the North side of a low wet area. It checked well with all the recovered witnesses.


Condition of Accessories: #1, Gone, #2, Gone, #3, Found Stump, #4, Found remains of stump, #5, Did not measure, #7, Gone, #8, Gone, #9, Found down, #10 (Black Oak), Found, #11, Found in good condition, #11, Found in good condition.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I accepted Griffin's 5" Concrete monument as a substantial marker for the corner as a careful and faithful reestablishment of the position of the original corner.

- |            |       |        |                          |     |
|------------|-------|--------|--------------------------|-----|
| 20" W. Oak | S76°E | 42.60' | (60 d. spike in S. side) | #11 |
| 6" W. Oak  | S17°E | 49.03' | (Dock spike in E side)   | #12 |
| 5" Maple   | N49°E | 33.68' | (60 d. spike in NW side) |     |
| 6" Maple   | S67°W | 42.57' | (60 d. spike in SE side) |     |

Signed by Robert L. Wetherell Date 10-13-04  
 Surveyor's Michigan License No. 24624

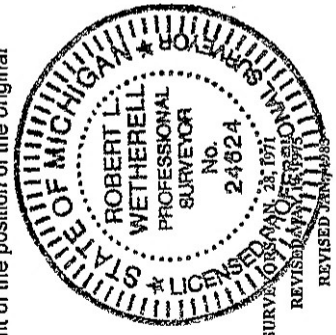

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345  
 CHAIRMAN R. J. W. DATE 10-12-04

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN 23, 1971  
 REVISED JAN 1978  
 REVISED JAN 1988

ADAPTED FOR WORD PROCESSING JANUARY, 1999