

AUG 31 1999

**SECTION LAND CORNER RECORDATION CERTIFICATE**  
FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in  
Lake \_\_\_\_\_

Located in: \_\_\_\_\_ Corner Code# \_\_\_\_\_

1. Public Land Survey \_\_\_\_\_  
T 18N R 14W I-8  
T R  
T R  
T R
2. Property Controlling S \_\_\_\_\_  
in Section \_\_\_\_\_  
T R
3. Miscellaneous S \_\_\_\_\_  
Property in Sec. \_\_\_\_\_  
T R
4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_  
S T R
5. Private Claims \_\_\_\_\_

RECORDED  
LAKE COUNTY, MI.  
LIBERO 04 PAGE 0219

JUL 23 3 07 PM '99

*Robert L. Wetherell*

REGISTER OF DEEDS

Register of Deeds Stamp & File Number \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1		6	5	4	3	2	1						
2													
3		7	8	9	10	11	12						
4													
5		18	17	16	15	14	13						
6													
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

I, Robert L. Wetherell, in a field survey on January 20, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, re-monumented, re-monumented, recovered, found as expressed below:

**I-8 - 1/4 Corner common to Sections 22 & 23, T18N, R14W**

**A. Description of original monument and accessories and/or subsequent restoration:**

- 1838 - S. Sibley, G.L.O.  
#1 - 14" Pine N50°W 94 Links
- #2 - 6" W. Oak S15°E 44 Links

1991 - R. L. Wetherell, LS 24624  
L.C.R.C. L. 03, Pg. 118

Set on line between Section corners at a distance doubled from the N.W. Section corner to occupation.  
at the N. 1/16 corner on West Section line (Sec. 23)  
#3 - 12" W. Oak N29°W 62.27'  
#4 - 10" B. Oak S63°W 50.01'  
#5 - 10" W. Oak S16°E 40.43'  
#6 - 14" W. Oak N87°E 23.68'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found the 1/2" Capped re-bar I set in 1991. Distance North to the Section corner is 2608.20'. Distance South to the Section corner is 2801.27'.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition, #4 Found in good condition, #5 Found in condition, #6 Found in good condition.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I replaced the 1/2" Capped re-bar with a 3/4" x 24" re-bar with Lake County Remon Cap, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 15" W. Oak N29°W 62.27' (60d spike in W. side) #3
- 14" B. Oak S63°W 50.01' (60d spike in S. side) #4
- 13" W. Oak S16°E 40.43" (60d spike in W. side) #5
- 16" W. Oak N87°E 23.68' (60d spike in N. side) #6

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP  
IN ACCORDANCE WITH P.A. 345  
CHAIRMAN *(Signature)*  
DATE 7-20-99

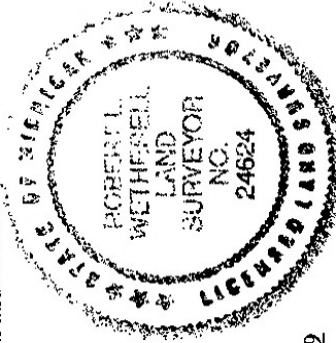

Signed by Robert L. Wetherell

Date July 21, 1999

Surveyor's Michigan License No. 24624