

FEB 07 2001

LAND CORNER RECORDATION CERTIFICATE

SECTION FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

2000 Alcona County Remonumentation

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 27N N. S., R. 8E E. W.	E-9
2. PROPERTY CONTROLLING IN SECTION	, T. N. S., R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	, T. N. S., R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

Alcona County
Remonumentation
Liber 2 Page 65

Filed for Record in
ALCONA COUNTY MICHIGAN
DORIS A GAUTHIER
On 09-20-2000 At 09:36 am.
LAND CORNER 9.00
REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, John F. Oliver do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on Aug. 10, 2000, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- E-9: 1838: GLO survey by L. Clason - set post and referenced
 1915: sur. by A. Freer - cor. is gray boulder 10 by 12 by 13
 with + on top with broken glass
 1973: Sur. by R. Miller - fd. 1/2" pipe
 1976: sur. by Porter's Survey - fd. 1/2" pipe
 1991: sur. by Hendricks Eng. - existing 1/2" iron rod
 1993: sur. by NE sur. - fd. nail over iron
 1994: sur. by Porter's Survey - fd. 1/2" rod

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

E-9: found 1/2" rod with no cap at road intersections N, E and S
 no evidence recovered from GLO survey of 1838

previous witnesses from surveys by R. Miller, Hendricks Eng. and Porter's Survey verify location for the corner. distances and alignment are compatible with surveys of 1973, 1976, 1991, 1993 and 1974.

accepted as the correct location for the corner

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-9: placed 1/2" rod with aluminum cap referenced:

- 16" oak stump - N 45°E - 40.73 ft
- 14" oak stump - N 41°W - 35.01 ft
- power pole - S 38°W - 56.25 ft
- 6" aspin - S 48°E - 70.86 ft
- 5" r.pine - N 58°W - 61.42 ft
- 14" oak - N 70°E - 49.79 ft

APPROVED LAND CORNER
P A 345 of 1990
ALCONA COUNTY


Date. 7-6-2000
County Rep. J.F.O.

SIGNED BY John F. Oliver DATE Aug. 10, 2000
 SURVEYOR'S MICHIGAN REGISTRATION NO. 19840

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

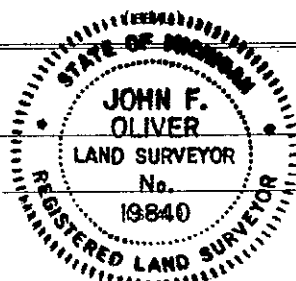

SURVEYOR'S MICHIGAN REGISTRATION NO. _____