

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Alger	Located In:	Corner Code #
(County)		
1. Public Land Survey	T 47N R 17W	A5
	T 47N R 17W	B5
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Aug 18 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5	●												
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(A5) Corner common to Sections 7-18 T47N-R17W and Sections 12-13 T47N-R18W. Remonumented in 1958 and recorded in 1959 by Billy D. Buckler, RLS. 2" pipe with Brass cap. 15" H. Maple N43E 19 links, 15" H. Maple S18E 38 links, 8" H. Maple S42W 37 links, 5" H. Maple N41W 37 links.

(B5) Quarter corner common to Sections 7-18. Corner remonumented in 1958 and recorded in 1959 by Billy D. Buckler, RLS. 2" iron pipe with brass cap. 12" H. Maple S55W 43 links, 8" H. Maple N73W 18 links.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(A5) Recovered three of the four 1958 witness trees in good condition. The 1958 monument and the Beech O.B.T. S61E noted in Buckler's record were not recovered. The monument appears to have been destroyed by earth-moving equipment. I remonumented the corner in accord with the record bearings and distances to the three remaining 1959 bearing trees. At the position for the corner I placed a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(B5) Recovered the 1958 monument as described, in good condition, and at record bearing and distance from the two 1958 witness trees, both in good condition with blazes overgrown. Left the monument in place and marked two new trees as described below. The original B.T. noted in the 1958 record was not recovered.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(A5) Set 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following:


20" Sugar N41E 12.7' "S7"  
 22" Sugar S13E 25.2' "S18"  
 12" Sugar S49W 24.5' "S13"  
 8" Sugar S36E 11.1' "S18 NBT"

Placed 4" cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.

(B5) Found 2" pipe with 2.5" dia. brass cap. Blazed, scribed, and set measuring nails in the following:

18" Maple S58W 29.3' "1/4S"  
 14" Maple N73W 12.5' "1/4S"  
 6" Maple S01W 20.5' "1/4S NBT"  
 8" Maple S40W 16.7' "1/4S NBT"

Bearings are magnetic. Distances are to nail with tag.

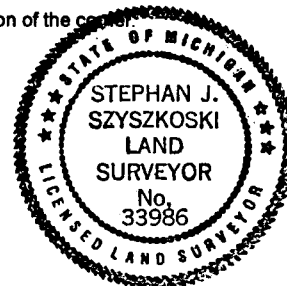

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 5/3/00

For the Michigan Department of Natural Resources - Forest Management Division