

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Alger</u> (County)	Located In:	Corner Code #	
1. Public Land Survey	T <u>47N</u> R <u>17W</u>	A <u>6</u>	_____
	T _____ R _____	_____	_____
	T _____ R _____	_____	_____
	T _____ R _____	_____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____	_____
	S _____ T _____ R _____	_____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____	_____
	S _____ T _____ R _____	_____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Aug 18 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (A6) Quarter corner common to Section 18 T47N-R17W and Section 13 T47N-R18W. Corner reestablished in 1965 and recorded in 1966 by F.J.Bray, RLS. 1" iron pipe with 4" aluminum cap. 9" Elm N25W 27.5 links, 7" H.Maple S46E 19.5 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (A6) Recovered the 1965 monument as described, in good condition, and at record bearing and distance from the H.Maple NBT, found in good condition with overgrown blazes. The Elm NBT was not recovered. Left the monument in place and made new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (A6) Found 1" pipe with 4" alum. cap.
 Blazed, scribed, and set measuring nails in the following:
 20" Maple S40E 12.9' "1/4S"
 5" Maple S43W 11.9' "1/4S NBT"
 12" Maple S78W 11.4' do
 5" Maple N62W 8.4' do
 Placed 3" cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.

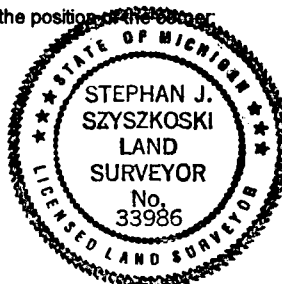

Signed by Stephan J. Szyszkoski Date 5/3/00
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division