

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan County
(County)

Located In:

Corner Code *##*

1. Public Land Survey		T <u>1N</u> R <u>12W</u>	<u>A-5</u>
		T _____ R _____	_____
		T _____ R _____	_____
2. Property Controlling in Section	<u>18</u>	T <u>1N</u> R <u>12W</u>	<u>9</u>
		S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.		S _____ T _____ R _____	_____
		S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Gary C. Bilow March 6, 1990

I, _____, in a field survey on _____, 1990, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(A-5) GLO set post Jan. 1831, on range line 57 links north of standard corner (M-5 of T1N-R13W) Beech 16" S10°E 27.72'; Beech 7" N13°E, 11.88'. No record of subsequent perpetuation.

(9) Corner not set in original survey. Found no record of prior monumentation.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(A-5) Found no monumentation at this position. No evidence of GLO bearing trees. Found standard corner M-5 (T1N-R13W) as recorded in L.C.R.C. L.2 - P.329 and accepted it as perpetuation of GLO monument. Found old wire fencing going east'ly from corner location. Fence meanders and is nearly obliterated and when projected westerly to range line, falls approx. 41' North of M-5. Rejected fence in favor of GLO call to standard corner and established corner at record falling 37.62' north of standard corner on range line defined by M-5 and M-4 of T1N - R13W as recorded. Set 1/2" re-rod encased in 4" dia. concrete cylinder with cast aluminum Michigan Department of Natural Resources cap.


(9) Set 1/2"x36" long re-rod encased in 4" dia. concrete cylinder with cast aluminum Michigan department of Natural Resources cap on line and equidistant between B-6 and C-6 as recorded.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(A-5) Set 4" dia. concrete monument
 S10°W 105.37' Set nail MDNR tag
 E. Face 32" Maple
 North 48.79' Set nail & MDNR tag
 W. Face Twin 6" Maple
 N53°E 35.1' Set Nail & MDNR Tag
 S. Face 5" Fruit Tree
 N85°E 30.49' RR Spike SW Face P/P
 South 37.62' Found 1" Iron bar at SE
 Cor. Sec. 12 T1N-R13W

(9) Set 4" dia. concrete monument
 N37°E 22.55' Set nail & MDNR Tag NW Face
 7" Elm
 N70°E 15.26' Set nail & MDNR Tag N. Face
 7" Elm
 S21°E 38.52' Set nail & MDNR Tag NW Face
 11" Fruit Tree
 N9°W 26.36' Set Nail & MDNR Tag E. Face
 1" Box Elder

Signed by Gary C. Bilow
 Surveyor's Michigan License No. 26453

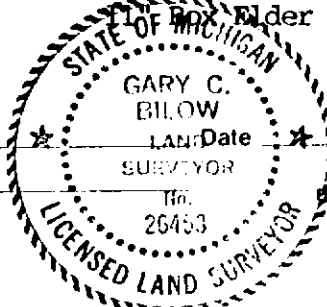

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983