

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Allegan</u> <small>(County)</small>	Located In:	Corner Code #/
1. Public Land Survey	T 1N R 13W	L-3
	T 1N R 13W	M-3
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

**Register of Deeds Stamp & File Number**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Gary C. Bilow, in a field survey on April 26, 19 90, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

(L-3) Corner established by Lucius Lyon, G.L.O. Deputy Surveyor, 1831  
 Accessories: Beech 16" N47°W 14 links; Beech 14" S41°E 8 links. Found no record of perpetuation or subsequent restoration.  
 (M-3) Corner established by Lucius Lyon, G.L.O. Deputy Surveyor, Dec. 1830  
 Accessories: Beech 12" S64°W 25 links; Beech 8" N29°W, 10 links. Found no record of perpetuation or subsequent restoration although corner is referred to in certificate for A-3 (T1N - R12W) Rec. L.2, P.149


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(L-3) Found no evidence of original monument or accessories. Found 3/4" iron rod at the south end of an old fence and in line with E-W tree ROW. Corner accepted by at least one adjacent land owner. Distance between L-3 and M-3 as found checks with GLO record.  
 (M-3) found and accepted 5/8" rebar 5" below gravel surface. Distance north to closing corner Sec. 7 T1N - R12W checks with GLO record. This 5/8" rebar has been accepted by local surveyors.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(L-3) Found 3/4" iron rod S87°W 12.5' 5" Cherry N09°W 25.0' 24" Maple N32°E 13.3' 24" Hickory Rod is at S. edge corner fence post	(M-3) Found 5/8" Rebar N27°E 57.00' rod spike in P/P N66°W 55.95' set spike and MNR Tag in 29" Walnut N14°W 55.82' set spike and MNR tag in guy pole North 47.55' Found 1" iron at NW Corner Sec. 7 T1N - R12W East 6' ± of N-S gravel road
---	--

Signed by Gary C. Bilow  
 Surveyor's Michigan License No. 26453

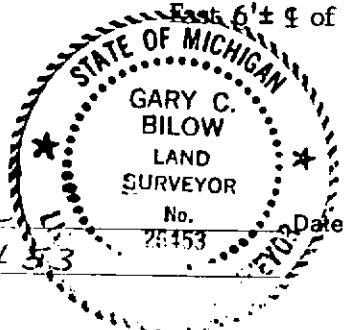

Date 8/1/90