

MAR 16 1994

For corners in

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

COMING Allegan County

Located in:

Corner Code #

1. Public Land Survey	T 3N R 14W	H-11
	T R	S 1/4 Cor.
	T R	Sec. 27
	T R	N 1/4 Cor.
2. Property Controlling in Section	S T R	Sec. 34
	S T R	Heath Twp.
3. Miscellaneous Property in Sec.	S T R	
	S T R	

REGISTER OF DEEDS
ALLEGAN COUNTY, MICH.
Joyce L. Blatter

1993 DEC 30 PM 2:44

FILED

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Kirk VanOrder, in a field survey on November 4, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

H-11

•GLO set post @ 39.83½ chains West of I-11.
26" Pine N38°E 13 links
7" Beech S2°W 10 links

•Exxel survey 6-11-1973 #73284 & #73287

•LCRC (L.2, P.108) 6-26-1973 3/4" iron

•H. MacDougall survey 5-1-1908 N 1/4 post
Fd. R.R. iron

Nail in side 26" Oak NE 70.21'
Nail in side P. Pole SE 51.32'
Nail in side Tw. 12" Oak SW 71.58'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-11

Found R.R. rail 15" below grade and in C/L of gravel intersection.
Found 1½" pipe 6½" below grade 2.78' SW of R.R. rail
R.R. rail most likely the older corner.

The 1½" pipe was improperly established and was discounted.
The R.R. rail is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-11

Removed 1½" pipe

Set standard Allegan Co. monument (3/4" x 10" with cap) above R.R. rail

Nail & Allegan Co. Remon. tag in NW side 19" W. Oak N40°E 86.94'


Nail & Allegan Co. Remon. tag in SW side Power Pole S44°E 53.36'

Nail & Allegan Co. Remon. tag in SE side Tw. W. Oak S42°W 74.12'

Nail & Allegan Co. Remon. tag in SW side 11" W. Oak N33°W 81.42'

Signed by

Kirk L. VanOrder

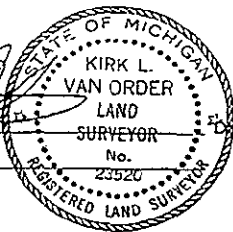

Date

12-30-93

Surveyor's Michigan License No.

23520

LIBER 004 PAGE 329