
## ALLEGAN COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE

COMMISSION Allegan	Filing Require	Filing Requirement of Act 74, Mich. P.A. 1970	
Allegan	Located In:	Corner Code ≠	FILE HEGISLER OF ALEGAN FAILS
Public Land Surv	T 4N R 13W T R T R T R T R R T R R R R R R R R R R	G-6 E 1/4 Cor. Sec. 16 W 1/4 Cor.	ED EN 2: PH
Property Controll in Section	STR	Sec. 15 Salem Twp.	¥ 43
Miscellaneous     Property in Sec.	S T R S T R		Register of Deeds Stamp & File Number
4. Lot No	, Recorded Plat		ARCBEECHIOL

I. <u>Kirk VanOrder</u>, in a field survey on <u>December 8</u>, 19, 93 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 an above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

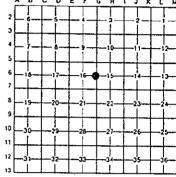

A. Description of original monument and accessories and/or subsequent restoration:

G-6			SE cor. garage	NW 36	5.7'	
•GLO set post @ 40.00 chains			•LCRC (L.1, P.342) 4-11-1972			
North of G-7.			1½" iron in monument box			
7" Beech	N31°E	ll links	C/L Manhole	S	20.01	
7" Beech	s71°W	35 links	SW cor. C.B. frame	N60°E	34.45	
•Burnips Corners Plat 12-1-1899,			NW cor. C.B. frame	S60°E	34.95	
E.P. Waterman, stone			•K.V.O. survey 3-15-1990 #90-2152			
.MacDougall notes - Fd. stone			Set capped \( \frac{1}{2} \) rerod			
SW cor. hou			C/L mon. box		7.35′	
Description of come	revidence found a	54 / and/or method applied in	SW cor. house restoring or reestablishing corner;	NE	49.92	

 $\frac{G-6}{\text{Found } 1^{1}_{2}}$  iron in monument box. Determined to be improperly established and was discounted.

Found '4" capped rerod. Rod agrees with plat of Burnips Corners (L.2, P.44) done by E.P. Waterman Dec. 1, 1899. Corner sits at the middle of the R.O.W. of intersection of Main St. & North St.

Accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced %" capped iron with standard Allegan Co. monument (3/4" x 24" steel rod with red plastic cap).
SW corner house with aluminum siding
NE corner stone foundation
NE corner concrete porch
SE corner concrete block foundation AZ. 55°26'± 49.93' AZ. 125°35′± AZ. 224°53′± AZ. 296°15′± 104.81' 46.691 146.91'

Signed by

23520

VAN ORDER LAND

SURVEYOR

Surveyor's Michigan License No.

B.

No. 23520

12-30-93

FORM APPROVED BY MICHIGAN STATE BOARD OF EARD SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983

LIBER 004 MARY 321

RED LAND

- F KIRK L