

LAND CORNER RECORDATION CERTIFICATE

* Filing Requirement of Act 74, Mich. PA 1970

For Corners In:
Arenac Located In _____ Corner Code # _____
 (County)


1. Public Land Survey T 20N R 3E F13
 T _____ R _____
 2. Property Controlling in Section S _____ T _____ R _____
 S _____ T _____ R _____
 3. Miscellaneous Property in Section S _____ T _____ R _____
 S _____ T _____ R _____

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on Aug. 24, 2004 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

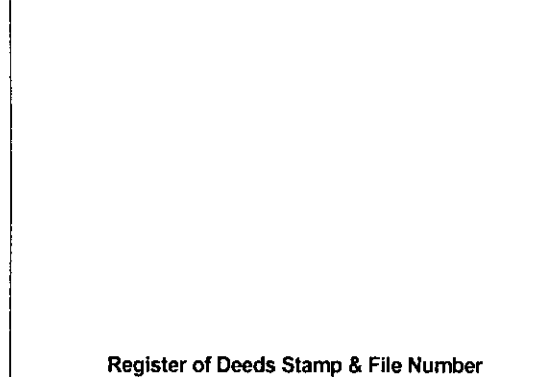

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

F13 – GLO – Set ¼ Post – L. Clason – 1837
 Pine 5" N5°E 20 L.
 Tamarak 6" N20°W 22 L.
 - MDOT Wit. Card – C. F. Roser - 1965 -
 (LCRC – L. 1, p. 232 – 1984)
 Set 2" pipe, 5' long and 18" above the ground.
 Mark Cedar guard post. Corner set by single Prop. between found corners E & W.
 10" Poplar S85°E 39.01'; 8" poplar S40°E 36.03';
 6" Maple, S70°W 19.77'; 8" Poplar N30°W 18.91';
 N89° 52'50" E 15.22' to N ¼ Sec. 4, T19N, R3E.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

F13 – Standard ¼ Corner common to Sec. 33 – Fd. 2" Iron pipe – Up 1.5' – per MDOT. No GLO evidence. MDOT Poplar BT's gone or dead. 2" pipe accepted as a careful and faithful re-establishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F13 – Drove stamped 2" Alum. Cap on 5/8" x 5' iron rebar into centerline of Fd. 2" pipe.
 Set Blue Carsonite Post 1' N.
 Set Orange Carsonite Post 1' W.
 S68°W 19.60' to set N & T in N. side 16" R. Maple scribed 'XBT' (MDOT)
 N10°W 51.36' to set N & T in W. side 14" R. Maple scribed 'SCBT'
 S26°E 40.00' to set N & T in W. side 6" Ash
 East 15.21' to 'F1' – T19N, R3E – 2" Alum. Cap in 2" pipe.



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 2/7/2005