

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970


<u>Arenac</u> (County)									
	Located In								Corner Code #
1. Public Land Survey	T	20N	R	4E					K12
	T		R						
2. Property Controlling in Section	S	T	R						
	S	T	R						
3. Miscellaneous Property in Section	S	T	R						
	S	T	R						

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on November 2, 2000 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

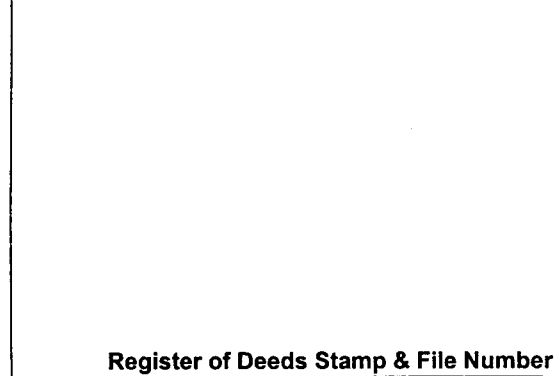

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35	●	36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- K12 – GLO – Set ¼ post – J. Mallett – 1846
- W. Pine 6" N26°W 18 L.
- Y. Pine 6" S71°E 23 L.
- CSR – FB. 6, P. 34-36 – 1907
- All evidence of ¼ P. obliterated
- Established on straight line and equal dist. between 2 & 3.
- Pine St. 24" N40 ½°E 51 ½
- Rec. Sur. - L.2, P. 137 – R.L. Miller – 1996 - Fence Cor.

B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:

- K12 – ¼ corner common to Sec. 35 & 36 – Found old down anchor post for old fences W & S. Dug around down post and found pieces of broken crockery. Dug down 1' x find 1 ½" 'U' iron 1.5' long surrounded by 40 total pieces of crockery. Fd. remains of 24" WPS at record bearing & distance per county record. Iron & crockery accepted as a careful & faithful re-establishment of the position of the original corner.
- Reference Pt. – Fd. D. Burgin Cap #29240 on 'T' iron S51°52'W 1.63' from K12. No record on this 'T' iron and doesn't agree with historical CSR position. 'T' iron not utilized as K12 in this survey.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- K12 – Replaced 1 ¼ 'U' iron in crockery with 4" DNR Alum. cap on 1" x 36" long galv. Iron pipe. Placed all found crockery & iron at base of monument as memorial.
- Set Blue Carsonite Post 1' E
- S51°52'W 1.63' to 'T' iron – Ref. Pt.
- N85°W 16.91' to N & T in S side 7" W. Oak scribed 'XBT'
- S20°E 9.83' to N & T in W side 13" Oak
- N40°E 35.56' to set spike in CL. remains 24" PS (CSR)
- N14°E 33.29' to to N & T in E side 3" Oak
- N46°W 3.55' to CL. 1" R. Pine



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 12/13/2001