

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga	Located In:	Corner Code #
(County)		
<b>1. Public Land Survey</b>	T <u>47N</u> R <u>33W</u>	<u>C10</u>
	T <u>47N</u> R <u>33W</u>	<u>B10</u>
	T _____ R _____	_____
	T _____ R _____	_____
<b>2. Property Controlling in Section</b>	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
<b>3. Miscellaneous Property in Sec.</b>	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

B10 Apr 24 2001  
C10 Apr 01 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		●	●	29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

**A. Description of original monument and accessories and/or subsequent restoration:**  
(C10) Quarter corner common to Sections 29 & 30. Established in 1852 by Francis S. Houck: "North corrected between Secs 29 & 30...40.015 Set qr post. Cedar 14 N19W 18 links, Y.Birch 16 S21E 34 links...80.03 Corner of Sections 19-20-29-30".  
(B10) Center of Section 30. Not established in the original survey. Found no subsequent record.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.**

(C10) The original post and accessories were not recovered. Found no evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 2635.90' North and South.  
(B10) Established the corner at the intersection of straight lines connecting opposite quarter corners. Corner falls in a thick tag alder swamp.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**  
(C10) Set 1"IDx32" iron pipe with 4" alum. MDNR tablet. Blazed and scribed:  
11" Y.Birch N04E 35.0' "1/4S NBT"  
8" Y.Birch S23E 73.7' do  
5" Maple S22W 22.6' do  
15" Y.Birch S57W 63.5' do  
Set sq'd spruce post adjacent. Bearings are magnetic. Distances are to notch in lower blaze  
(B10) Set 1"IDx32" iron pipe with 4" alum. MDNR tablet. Blazed and scribed:  
11" Cedar N37W 20.5' "C1/4 BT"  
7" Cedar N44E 18.8' do  
7" Cedar S88E 25.5' do  
10" Cedar S25E 37.2' do  
Set sq'd cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

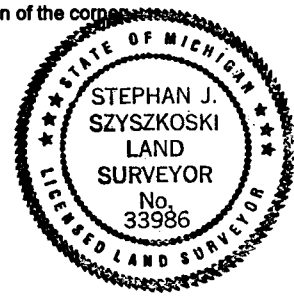

Signed by Stephan J. Szyszkoski Date 5/1/2001  
Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division