

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>47N</u> R <u>33W</u>	<u>89</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>30</u> T <u>47N</u> R <u>33W</u>	<u>11</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

89 Jul 02 2001
 11 Apr 24 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(89) Quarter corner common to Sections 19-30. Remonumented in the original position by K.L.Sackett, RLS in 1980. Set 1"ID x 32" iron pipe with 4" alum. cap. 16" Maple N69W 21.2'.
 (11-Sec. 30) Southwest 1/16 corner, Section 30. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(89) Recovered the 1980 monument in good condition and at record bearing and distance from both the 1980 NBT, now a cut stump with lower blaze and scribing visible, and from the original BT Cedar 8 S33W 33 links, now down with blaze and scribing plainly visible. Left the monument in place and made new witnesses as described below.
 (11-Sec. 30) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(89) Found 1"ID iron pipe with 4" alum. MDNR cap. Blazed and scribed:	(11) Set 1"IDx32" iron pipe with 4" alum. MDNR tablet. Blazed and scribed:
5" Spruce N75E 10.2' "1/4S N8T"	15" Y.Birch N34E 50.1' "1/16S BT"
14" Y.Birch S23E 34.3' do	12" Y.Birch N84E 37.3' do
17" Maple S66W 32.5' do	14" Maple S31W 2.5' do
13" Y.Birch N41W 55.2' do	18" Maple N55W 26.1' do
The 1980 squared post is adjacent.	Placed sq'd cedar post adjacent.
Bearings are magnetic. Distances are to notch in lower blaze.	Bearings are magnetic. Distances are to notch in lower blaze.

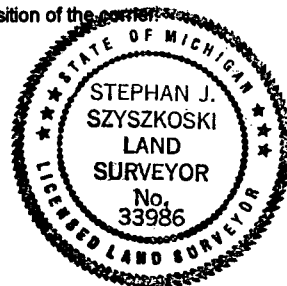

Signed by Stephan J. Szyszkoski Date 5/1/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division