

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga

(County)

Located In:

Corner Code #

1. Public Land Survey

T 47N R 33W A13
 T R
 T R
 T R

2. Property Controlling in Section

S 30 T 47N R 33W 10
 S T R
 S T R

3. Miscellaneous Property in Sec.

S T R
 S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

10 Feb 01 2001

A13 Jan 10 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5			4		3		2			1	
3													
4	7		8		9		10		11			12	
5													
6	10		17		16		15		14			13	
7													
8	19		20		21		22		23			24	
9													
10	30		29		28		27		26			25	
11													
12	31		32		33		34		35			36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(A13) Southwest corner of the township. Remonumented in the original position by A.O.Enger in 1968. 1" I.D. x 36" iron pipe with 4" aluminum cap. Balsam Fir 7 S3W 18 links. 1953 witnesses by Northern Paper Mills remeasured by Enger: Balsam Fir 12 N52W 11.5 links, Balsam Fir 12 N66E 42.5 links.
 (10-Sec. 30) South 1/16 corner common to Sections 30 T47N-R33W and 25 T47N-R34W. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(A13) Found the 1968 monument, as described, in good condition and at record bearing and distance from the NBT Balsam SW, now a rotting stump, and from the NBT Balsam NW, a rotting stump. The remains of the NBT Balsam NE were not recovered but may be under the snow. Left the monument in place and made new accessories as described below. A 1" ID iron pipe with a 2" brass NPM cap and a 3/4" ID iron pipe are adjacent to the monument
 (10-Sec. 30) Established the corner midway and on a line of mean true bearing between Section corner 1318.60' South and Quarter corner 1318.60' North. From the position thus established, I found a 1" IDx36" iron pipe capped with a 4" dia. aluminum Michigan Dept. of Conservation tablet, not of record, S30E 3.7' distant. I removed this monument and placed it at the established position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(A13) Found 1 ID iron pipe with 4" alum. MDNR tablet. Blazed and scribed:	(10) Set 1 ID iron pipe with 4" alum. cap. Blazed and scribed:
7" W.Spruce S88E 26.0' "S6 NBT"	8" Sugar N74W 15.6' "1/16S BT"
4" W.Spruce S37E 30.0' "S6 NBT"	6" Maple N70E 11.9' do
4" Balsam S44W 29.5' "S1 NBT"	7" Maple S41E 30.95' do
8" W.Spruce N18W 11.2' "S36 NBT"	14" Spruce S29W 21.9' do
Bearings are magnetic. Distances are to notch in lower blaze.	Placed sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

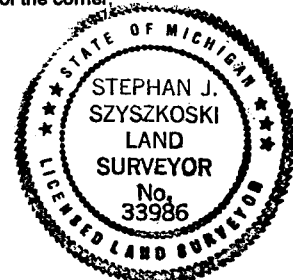

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/1/2001

For the Michigan Department of Natural Resources - Forest Management Division