

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga

 (County)

Located In:

Corner Code #

1. Public Land Survey

T 47N R 34W G5
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling
 in Section

S _____ T _____ R _____
 S _____ T _____ R _____

3. Miscellaneous
 Property in Sec.

S _____ T _____ R _____
 S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jul 03 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5							●						
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


(G5) Corner common to Sections 9-10-15-16. Corner remonumented in 1966 and recorded in 1967 by Billy D. Buckler RLS: " This corner placed at intersection of old blazed lines to north, south, east and west. Found wood post at corner. No other evidence. 1" pipe with 4" aluminum cap. 12" Hard Maple S73E 20.5', 10" Y.Birch S50W 27.5'."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G5) Recovered the 1966 monument, as described, in good condition, and at record bearing and distance from the 1966 witnesses. The Maple is in good condition with overgrown blazes. The Y.Birch is now a decaying stump. Left the monument in place and made new witnesses as described below. No land survey was made here this date. This record is made solely to perpetuate the 1966 position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G5) Found 1" ID iron pipe with 4" alum. MDOC cap. Blazed and scribed:
 8" Y.Birch S63W 30.4' "S16 NBT"
 12" Sugar N20W 27.5' "S9 NBT"
 9" Y.Birch N36E 29.9' "S10 NBT"
 14" Sugar S73E 20.5' (the 1966 NBT)
 Sq'd cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

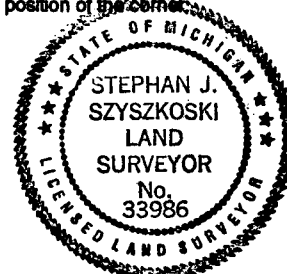

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 8/15/01

For the Michigan Department of Natural Resources - Forest Management Division