

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>49</u> N R <u>32</u> W	<u>C7</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Sep 15 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (C7) Corner common to Sections 17-18-19-20. Established in 1852 by Guy H. Carleton: "...Corrected between 18 and 19...75.19 Set post corner of Secs. 17-18-19-20. Spruce 9 N62E 20 links, Cedar 10 N60W 22 links". Recovered in 1854 U.S. Examination survey: "West between 17 & 20...78.43 Section corner. Cedar 16 N58W 20, Spruce 10 N52E 17". Shown on 1993 survey by R.W.Crampton, PS24591: "Set 3/4" iron pipe with cap. Witnessed with survey tag nailed to: 3" Maple tree N32W 10.93', 5" Ash tree N77E 9.62', 6" Maple tree S51W 27.28', 6" Maple tree S28E 13.58". R.W.Crampton told me he monumented this corner in accord with local evidence he recovered: a fd. 10" blazed cedar and a Ford Motor Co. location poster.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C7) Original post and accessories were not recovered. Found the 1993 iron pipe, as described, in good condition and at record bearing and distance from the 1993 accessories. Distance to monumented Section corner to west checks with 1854 examiner's record and distances east to reestablished N1/4 and probable original NE 20 are in good proportion to same record. Distance south to 1/4 cor. checks well with original record. Accepted the pipe as the best available evidence of the position of the original corner. Left the pipe in place. The 1993 witnesses are reiterated below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C7) Found 3/4" iron pipe.
 Found washers #24591 with measuring nails in the following blazed trees:
 3" Maple N32W 10.93'
 5" Ash N77E 9.62'
 6" Maple S51W 27.28'
 6" Maple S28E 13.58'

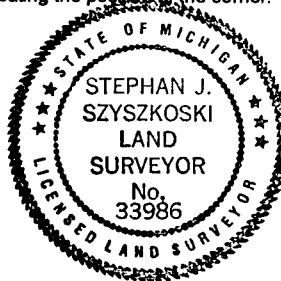

Signed by Stephan J. Szyszkoski Date 10/7/99
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division