

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Baraga</u> <small>(County)</small>	Located In:	Corner Code #	
1. Public Land Survey	T <u>53N</u> R <u>30W</u>	<u>B13</u>	
	T <u> </u> R <u> </u>	<u> </u>	
	T <u> </u> R <u> </u>	<u> </u>	
	T <u> </u> R <u> </u>	<u> </u>	
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>	
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>	
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>	
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 29 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


A. Description of original monument and accessories and/or subsequent restoration:
 (B13) Quarter corner common to Section 31 T53N-R30W and Section 6 T52N-R30W. Reestablished in 1973 by A.O. Enger RLS and described on Pages 141-142 of Liber 1 of LCRCs, Baraga County Records. 1"IDx36" Iron pipe with 4" alumina cap. Cedar 6 N73E 12.9', Cedar 15 N79W 11.5'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(B13) Recovered the 1973 monument as described, in good condition and at record bearing and distance from both NBTs. The NBT Cedar NE is now dead with scribing visible. The NW is in good condition with scribing visible. Accepted the monument as a careful and faithful reestablishment of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(B13) Found 1" ID I. pipe with 4" alum. MDOC cap. Blazed and scribed:
 10" Sugar N53E 0.9' "1/4S NBT"
 14" Hemlock S63E 20.2' do
 12" Hemlock S04W 24.1' do
 The 1973 wit:
 13" Cedar N76W 11.5' do
 Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

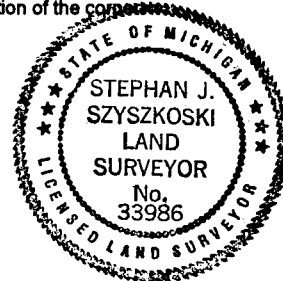

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/19/02