


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Baraga</u> (County)	Located in:	Corner Code #	
1. Public Land Survey	T <u>53N</u> R <u>30W</u>	C10	
	T <u> </u> R <u> </u>		
	T <u> </u> R <u> </u>		
	T <u> </u> R <u> </u>		
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>		
	S <u> </u> T <u> </u> R <u> </u>		
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>		
	S <u> </u> T <u> </u> R <u> </u>		

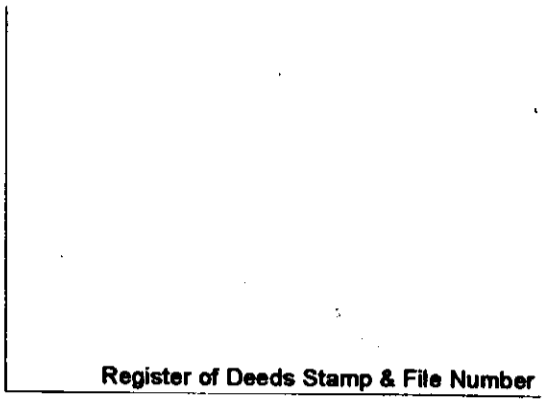

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 29 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:
 Quarter corner common to Sections 29-30. Remonumented in 1953 by D.C.DeLaMater: This corner was pointed out to me by LeRoy Stevens, District Forester, of Baraga. One original BT still in place, in fair condition. Set 1" pipe with 4" brass cap. 12" Cedar S89W 17 links, 8" Hemlock S32E 11 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 The 1954 monument was recovered, laying on the ground, having been extracted from its 1954 position by persons unknown, about 100 feet from the 1954 position. Recovered the 1954 N8Ts, the Cedar in good condition, the Hemlock now a rotting stump. Recovered the hole created when the monument was removed and replaced the 1954 monument in the hole, at record bearing and distance from the witnesses. Drove the monument to refusal and made it firm in a 2.8'x2.6'x1.5' high rock mound.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Reset 1954 monument, 1" ID I. pipe with 4" brass MI Dept. of Cons. cap. Blazed and scribed:
 14" Hemlock N35E 19.3' "1/4S N8T"
 9" Cedar S04W 15.5' do
 9" Hemlock N36W 45.1' do
 12" Cedar N85W 11.1' (the 1954 wit. found with scribing and notch visible)
 Bearings are magnetic. Distances are to notch in lower blaze.



Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 7/31/02