

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF: Section 18 LOCATED IN: Irving Twp., Barry Cty.

	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. <u>4</u> N. R. <u>9</u> W.	A-6 B-7 C-6 C-7
2. PROPERTY CONTROLLING IN SECTION _____ T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____	_____
5. PRIVATE CLAIMS _____	_____

NO. 319

# FILED

OCT - 2 1981

**HOWARD J. FERRIS**  
Barry County Register of Deeds  
At 1:18 P.M.

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Paul E. Van Kooten, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on April 8, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-6: Found nothing, set capped iron holding government distance and line from NW corner of Section 18, T4N, R9W thru East 1/4 corner Section 13, T4N, R10W
- B-7: Found nothing, set 1" iron on fence line to south and midway between fences on sides of east - west trail (Crane Road)
- C-6: Found nothing, set 1 1/2" solid rod by extending line and distance from SE corner of Section 18-4-9 thru East 1/8 corner of SE 1/4, Section 18-4-9
- C-7: Found 1/2" rod at intersection of roads to east, west and south


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p><u>A-6:</u> West 1/4 corner <u>W 1/4 Cor 18</u> Spike in E side 12" Oak Spike in S'yly side 16" Oak Spike in N'yly side 20" Oak E 1/4 corn. Sec. 13-4-10 Centerline road</p>	<p><u>C-6:</u> East 1/4 corner <u>18</u> N 28.20' Sq. spike in N'yly side 14" Shagbark Hickory E-SE 30.70' Sq. spike in S side 20" Maple SE 42.61' Sq. spike in SW side 12" Hickory N 20.79' Sq. spike in W'yly side 24" Maple E 15'</p>	<p>NE 39.15' W 32.90' SE 42.38' S-SW 59.37'</p>
<p><u>B-7:</u> South 1/4 corner <u>S 1/4 Cor 18</u> Sq. spike in W side 20" Oak Sq. spike in W side 14" Oak Sq. spike in S side 12" Oak</p>	<p><u>C-7:</u> SE corner <u>18</u> Nail &amp; tag in 14" Maple Sq. spike in W side 16" Maple Nail in corner fence post Sq. spike in N side 6" Poplar</p>	<p>SE 57.23' S-SE 75.01' NE 36.90' W-NW 50.55'</p>

SIGNED BY Paul E. Van Kooten - Medema, Van Kooten & Assoc., Inc. DATE \_\_\_\_\_  
SURVEYOR'S MICHIGAN REGISTRATION NO. 8618

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

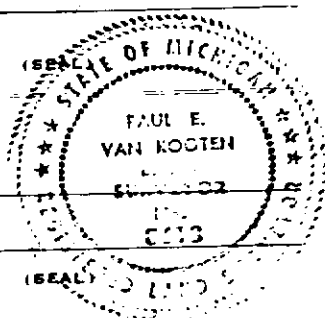

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_