MAR - 7 1999

REMON. COR. G-9, WILLIAMS TWP.

SECTION For corners in Bay	Filing Requirement of Act 74, Mich. P.A. 1970							
(County)	Located in:	Corner Code #	<u> </u>	REGISTER BAY COUNT	DEC			ı
1. Public Land Survey	T <u>14N</u> R <u>3E</u> T R T R	G-9		:<□ % .	C - J A		RECORDED	
2. Property Controlling S in Section S3. Miscellaneous S				F DEEDS MICHIGAN	e: 39		0	
Property in Sec.	TR		Register of Deeds Stamp & File Number					
Lot No, Recorded Plat Private Claims			АВ	CDEF	G H I	IJ	K	L

3

5

6

7

8

9 10

11

12

18


I, <u>JERRY L. JONES</u>, in a field survey on <u>August 13</u>, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned on lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

13 A. Description of original monument and accessories and/or subsequent restoration:

G-9 Corner common to Sections 21, 22, 27 and 28

> Survey by Glo, Harvey Parke, 1831, set post Survey by MDOT, 1957, found Survey by Hunter and Whittier, 1975, found Survey by Ayres Associates, 1981, 1993, found 3/4" rod Survey by Edmands Engineering, 1982, 1984, found mon box Survey by Burgin, 1989, 1991, found 5/8" iron

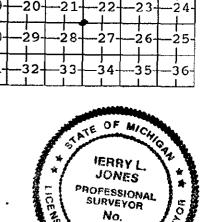

19838

POFESSIONA

15

16

WITNESS NOTE: Witnesses from above surveys and LCRC's are available in dossier file; which was presented to peer review committee and Is on file at the Register of Deeds Office.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- G-9 Corner common to Sections 21, 22, 27 and 28

Found 3/4" rod in mon box per surveys by MDOT, Hunter-Whittier, Ayres Associates, Edmands Engineering, and Burgin

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Corner common to Sections 21, 22, 27 and 28

Found 3/4" rod in mon box per surveys by MDOT, Hunter and Whittier, Ayres Associates, Edmands Engineering, and Burgin; replaced rod with 5/8" rod with brass cap stamped Bay County Remonumentation PS 19838, and is accepted as the best available evidence of the position of the accepted

North, 35.40', south edge 8" steel expansion joint, rec 35.3', 35.4', 35.18' N 35 Deg W, 30.18', nail in top of guard rail post, rec 30.16' N 35 Deg E, 30.20', nail in top of guardrail post, rec 30.17' S 35 Deg W, 31.50', nail in top of guardrail post, rec 31.53'

APPROVED LAND CORNER P.A. 345 OF 1990 - Bay County Date 44 Sep 198 MJM

Michael MacDonald P.S. County Representative

Signed by Surveyor's Michigan License No. 19838

Date __ 12/01/98

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971

Revised May 14, 1971

Revised Jan., 1983