

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 25 ^{N.} ● R. 14 ^{W.} ●	A-9; B-9; C-9; D-9
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ ^{N.} S. R. _____ ^{E.} W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} S. R. _____ ^{E.} W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 11, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. - Description of original monument and accessories and/or subsequent restoration:~~

C. (continued)

D-9
Drove 1½"x36" pipe
8" Maple N54°W 47.27
20" Maple N55°E 43.91
12" BCherry S73°E 101.16
Ctr. M-115 N89°19'W 105.0
Set ced.post w/loc. tag
Due N 33'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-9 Restored SW corner of Sec. 19 at R.L.S. H. Bruning position for corner per proration to his survey of Sec. 19. Corner is in approx. center of N-S dirt co. road. Fence remains to E are due S, one rod. Corner falls in line with irregular horse & buggy road grade to E & W.
 - B-9 Found 1" pipe as recovered and accepted by RLS H. Bruning in 1969.
 - C-9 Found 1½"x24" pipe at intersection of gravel roads E-W-S. Pipe fits 1937 MSHD witnesses.
 - D-9 Recovered positive shadow of pipe to depth of 6" in subsoil. Shadow fits MSHD (1936±) wit. (Map.NE) exactly and tie to fence post (now down-fd. post bottom) north within 0.8'. Accepted shadow position & drove 1½"x36" pipe. Corner falls in ctr. of E-W gravel road.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-9	B-9	C-9
Drove 1½"x36" well point	Fd. 1" pipe & added DNR mon. & cedar post	Fd. 1"x24" pipe
Set ced.post w/loc.tag	6" Maple N82°E 34.5	24" Maple N65°E 74.02
Due E 33.0	6" Maple S51°E 42.0	9" W.Pine S41°E 61.35
36" Maple S80°W 55.87	6" Maple S37°W 33.7	8" R.Pine S46°W 54.47
18" Maple N29°E 83.55	Ctr. 2' creek Due N 35'	Set ced.post w/loc. tag
10" Cherry S28°E 70.15		Due N 33'


SIGNED BY Carl F. Roser DATE 3-16-76

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

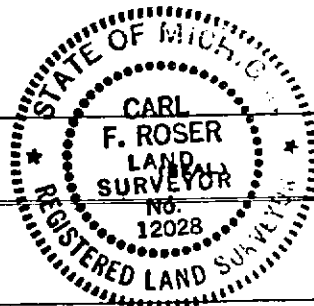

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

WELDON TOWNSHIP
BENZIE COUNTY