


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Benzie</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>26N</u> R <u>14W</u>	<u>B-3</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

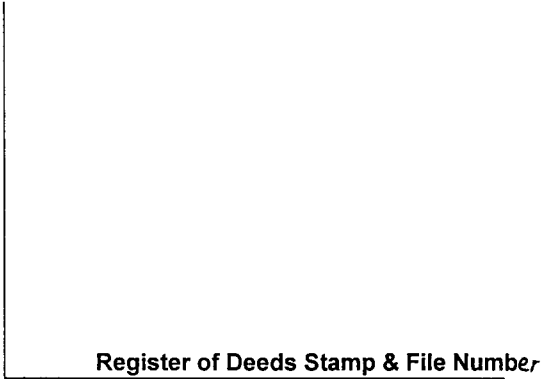

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Craig W. McVean, in a field survey on April 21, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3		●											
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

B-3 - GLO - Set 1/4 post Alvin & Austin Burt - 1839
 Cedar 9" N2°E 14L
 Pine 10" S8°E 26L
 -Co. Bk. 2, P. 126 - Sub. Of Sec. 7, T26N,R14W. - F. Haswell - 1900±
 Drove cedar post, set as lost corner, old corner extinct.

R.M. Harris - File # 96-3658 - 1996
 Recovered about 1 1/2' of pointed base of post about 1' below surface; well preserved in mud. Replace w/ 1 1/4" Pipe & steel post.
 8" Tamarack S46°E 17.27'
 6" Tamarack N39°W 19.16'
 4" Cedar S54°W 11.11'
 8" Cedar N5°E 7.80'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-3 - 1/4 Corner common to Sec.'s 6 & 7, T26N,R14W. FND. 1 1/4"x3' long Iron Pipe in Cedar/Tamarack swamp per RMH. Fits Haswell's Subdivision distances closely E. & S. Pipe accepted as best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-3 - Drove 1"x4' long Galv. Iron Pipe w/ 4" DNR Alum. Cap over 1 1/4" Pipe. (Now RMH Pipe is down 3.5'±.)
 Add soil, muck, and moss around.
 * S50°W 10.98' to set N&T in SW. Side 4" Cedar - scribed 'XBT'
 * N46°W 19.24' to set N&T in S. Side 7" Tamarack - scribed 'XBT'
 N73°W 34.27' to set N&T in N. Side 6" Cedar - scribed 'XBT'
 *S48°E 17.13' to set N&T in NE. Side 9" Tamarack - scribed 'XBT'
 South 1.35' CL. Steel fence post - FND. leaning 45°, straightened & drove down.
 Set blue Carsonite post 1' N.

*RMH nail above



Signed by Craig W. McVean
 Surveyor's Michigan License No. 39088

Date 8/27/2002