


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Benzie</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>27N</u> R <u>14W</u>	<u>B-11</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

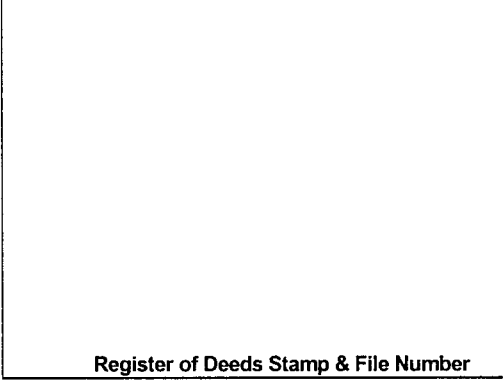

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Craig W. McVean, in a field survey on May 7, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

- B-11 - GLO - Hemlock 18" (Corner Tree) - Lucius Lyon - 1850
 Sugar 6" N18°W 37L
 Beech 6" S43°E 27L
- Co. Rec. 1, P. 88 - Geo. Steele - 1867
 Reset ¼ Corner from original BT's.
- Co. Bk. II, P. 150-151, Sec. 30 Sub. - F. Haswell - 1907
 Drove new cedar post 4", 3' deep from original witness trees.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- B-11 - ¼ Corner common to Sec.'s 30&31, T27N, R14W. FND. intersection of fences N & E w/ 2 rotted cedar anchor posts lying nearby. FND. B.J. Jenema Cap # 25850 on ½"x 18" Rebar at surface. Dig down and find rotten cedar post bottom down 0.6'±, 1.6' long x 0.6" dia. w/ flat bottom WSW of B.J. Jenema Cap & Iron. No post under B.J. Jenema Cap & Iron. Dig below first post & find second cedar post bottom 2.1' long x 0.6" dia. w/ flat bottom slightly leaning NW'ly; straighten and use bottom post for corner position. Fits Haswell distance N. to B-10. Set 1"x 4' long Galv. Iron Pipe w/ 4" DNR Alum. Cap. Reset FND. top post on N. side & bottom post on S. side of Mon. as memorials. DNR Monument accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- B-11 - 1"x 4' long Galv. Iron Pipe w/ 4" DNR Alum. Cap. Built ring of stone.
 N6°W 16.76' to set N&T in E. Side 8" Fir - scribed 'XBT'
 East 13.52' to fnd. nail in N. Side 9" Fir - scribed 'XBT'
 S85°W 24.39' to set cabin spike at face of 3' x 1.5' boulder.
 S26°E 198.83' to set N&T in W. Side 34" W. Pine - scribed 'XBT'
 Set blue Carsonite post 1' SW.
 Reset BJJ Cap & Iron in original position 0.48' E.



Signed by Craig W. McVean
 Surveyor's Michigan License No. 39088

Date 8/27/2002