

BRANCH COUNTY REMONUMENTATION CORNER
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>BRANCH</u> (County)	Located In:	Corner Code ##
1. Public Land Survey	T <u>6S</u> R <u>6W</u>	<u>L-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

REC'D FOR RECORD
STATE OF MICHIGAN
BRANCH COUNTY

94 MAR 10 AM 9:48

REGISTER OF DEEDS

II 288

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Edward W. Reed in a field survey on December 9, 1993
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

QUARTER CORNER COMMON TO SECTIONS 1 & 12, T6S, R6W.

- 1829: W. Brookfield, GLO Dept. Surveyor. 40.42-Set quarter section post at average distance.
- 1879: B Knowles, Surveyor. Buckeye 4 N11W 47 3/4; Maple 3 N12E 49 3/8
- 1931: R.V. Terrill, Surveyor. Stone, brick & earthen, Maaple N3/4W 68 1/4; Maple N13 1/2 W 47 1/2;

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


All witness now gone, dug two large holes, unable to locate any evidence of corner, possibly removed with road construction.
Set corner on line between northeast and northwest section corners and equal distance.

Set 1/2" x 18" rebar iron with ID cap in CI monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Rebar iron as noted above.
In line with fence running south
N 39 W 61.7', Telephone pedestal
N 9 E 82.1', SW corner house
N 54 W 77.4', center 24" Hickory
S 20 E 25.6', center 30" Maple

And is accepted as a careful and faithful reestablishment of the position of the original corner.

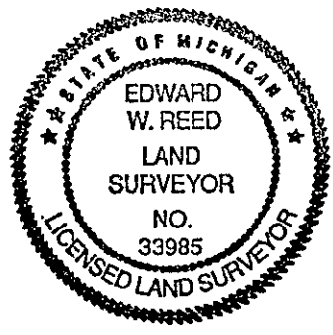

Signed by Edward W. Reed Date December 9, 1993
Surveyor's Michigan License No. 33985