

1993

COMMISSION

BRANCH COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

BRANCH (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>7</u> S R <u>6</u> W	C - 1
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

264

Register of Deeds Stamp & File Number

REC'D FOR RECORD
 STATE OF MICHIGAN
 BRANCH COUNTY
 93 DEC 27 AM 10:07
James J. Morrison
 REGISTER OF DEEDS

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

T7S, R6W

I, EDWARD R. REED, in a field survey on DECEMBER 1, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-1: SECTION CORNER 5/6 ON NORTH TOWNSHIP LINE OF T7S, R6W.

GLO = NOV. 1825 - W. BROOKFIELD, DEP. SURVEYOR: "N BETWEEN SEC 5 & 6, 80.09 - INTERSECT N BOUND LINE 37 LKS E OF COR POST & SET POST COR SEC'S 5 & 6. BEECH 6 S24W 14, BEECH 10 S28E 39".

GLO = 12/16/825 - W. BROOKFIELD, DEP. SURVEYOR: "THE FOLLOWING CORRECTIONS ARE MADE ON THE SOUTH BOUNDARY LINE T6S R6W. ERASED THE POST CORNER OF SEC'S 31 & 32 & MOVED IT 128 LKS TO THE WEST."

4/25/1881- M. KNOWLES, DEP. CO. SURVEYOR: "E - FD STONE."

9/16/1882- CH. HAMILTON: "AT D FOUND SEC. COR. STONE IN HIGHWAY."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

DUG TO DEPTH OF OVER 3 FEET & STILL IN ROAD GRAVEL. UNABLE TO FIND STONE. IT APPEARS THAT STONE MAY HAVE BEEN REMOVED IN ROAD BUILDING. REESTABLISHED CORNER BY PROTRACTION OF SECTION LINES FROM SOUTH, EAST, WEST, AND NORTH USING COLDWATER TWP. T6S, R6W (SECTION LINE 31/32), AND PRORATION OF GLO OFFSET OF 37 LINKS PLUS 128 LINKS.

SET A 1/2" X 18" REBAR IRON ROD WITH I.D. CAP #7437, IN MONUMENT BOX, AT THIS POINT, AS A CAREFUL AND FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-1: SECTION CORNER 5-6, ON NORTH TOWNSHIP LINE, T7S, R6W.

SET A 1/2" X 18" REBAR IRON ROD WITH I.D. CAP #7437, IN MONUMENT BOX.

S 50 E 70.40' TO NAIL ON W. SIDE 42" MAPLE.

S 01 E 155.00' TO NEAR FACE OF POWER POLE.


S 45 W 58.10' TO TOP CENTER OF TELEPHONE PEDESTAL.

WEST 111.50' TO IRON ROD IN MONUMENT BOX, (SECTION CORNER C-13, T6S, R6W, COLDWATER TWP.)

AND IS ACCEPTED AS A CAREFUL AND FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.

Signed by *Edward R. Reed*

Surveyor's Michigan License No. 7437

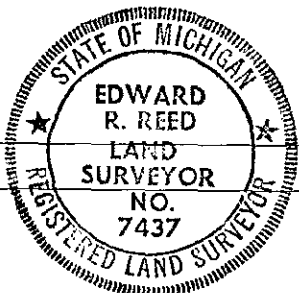

Date 12/01/1993