

1993

CALHOUN COUNTY REMONUMENTATION

COMMISSION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

CALHOUN

(County)

Located In:

Corner Code #

- 1. Public Land Survey      T 3 S R 8 W      K-11  
                                   T \_\_\_\_\_  
                                   T \_\_\_\_\_  
                                   T \_\_\_\_\_
- 2. Property Controlling    S \_\_\_\_\_  
    in Section               S \_\_\_\_\_  
    Miscellaneous          S \_\_\_\_\_  
    Property in Sec.        S \_\_\_\_\_

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

CLERK-REGISTER  
CALHOUN COUNTY, MICH.  
ANNE D. NORDLANDER

OCT 26 10 15 AM '93

RECORDED

Register of Deeds Stamp & File Number

I, DONALD J. DAVIS, in a field survey on SEPTEMBER 28, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

SOLID TILE SET IN RESURVEY BY HODGMAN IN 1884.

3" MAPLE N 89° W 39½ LINKS.

3" MAPLE S 20-3/4° W 103½ LINKS.

TILE WITH RR SPIKE CHAMBERS 1957.

24" MAPLE S 80° E 29.00'.

24" MAPLE S 25° E 103.5'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND ½" IRON ROD ON CENTERLINE OF ROAD.

TILE DESTROYED BY ROAD CONSTRUCTION.

IRON SET FROM WITNESSES BY FORMER SURVEYOR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET BERNTSEN MONUMENT WITH BRASS CAP IN MONUMENT BOX.


10" MAPLE N 40° W 52.68', NAIL & TAG.

NAIL & TAG 34" MAPLE S 70° E 30.20'.

NAIL & TAG 34" MAPLE S 25° W 69.30'.

32" MAPLE S 20° E 104.27'.

LIBER 1711 PAGE 088

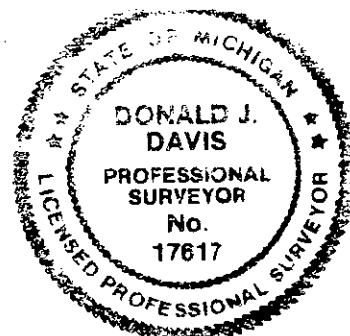

Signed by

*Donald J. Davis*

Date OCTOBER 13, 1993

Surveyor's Michigan License No. 17617