

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

CHIPPEWA COUNTY

2 corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>42</u> ^{N.} S. R. <u>2</u> ^{E.} W.	<u>C-7; C-II;</u>
2. PROPERTY CONTROLLING IN SECTION	T. _____ S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, RLS, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9/5/74, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- Corners placed originally by John Mullet, D.S. in 1845.
 - C-7; Section Corner, 17-18-19-20. Bearings were:
Cedar 10", N55W, 8 Lks. and Cedar 12", S55E, 15 Lks.
 - C-II; Section Corner, 29-30-31-32. Bearings were:
Cedar 9", S50W, 12 Lks. and Cedar 9", N72E, 25 Lks.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- C-7; Corner replaced from two Bearing trees, both down and in poor condition. Found overgrowth on face, with Notch on the NW stump. Found an un-recorded witness tree; a Tamarack 10", S30W, 14 Lks, with scribe marks "19" very plain.
 - C-II; Corner replaced from the remains of both Cedar stumps. Found overgrowth and part of faces with Notch on the SW stump. Found old blazes to North and South.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Placed 1" Pipe with 4" Aluminum Cap, at both Corners.
 - C-7; New Bearings:
11" W.Pine, N87E, 55.7' and 5" Cedar, N73W, 40.4' and 5" Cedar, S40W, 52.0'.
 - C-II; New Bearings:
8" Cedar, N13E, 11.5' and 14" Cedar, N79W, 10.2'.


SIGNED BY Billy D. Buckler *Billy D. Buckler* DATE 9/28/76

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887.

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

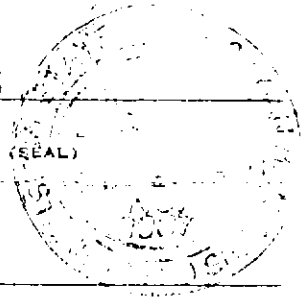

SURVEYOR'S MICHIGAN REGISTRATION NO. _____