

Chippewa Co.

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Chippewa Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>42</u> <sup>N.</sup> S., R. <u>2</u> <sup>E.</sup> W.	<u>I-7, I-5, J-7</u>
2. PROPERTY CONTROLLING IN SECTION_____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION_____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-12, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
Corners set by John Mullett, D.S. in 1845.

- I-7 Sec. Cor. 14-15-22-23, bearings were: Sugar 10", S70°W, 8 lks. & Sugar 7", N65°E, 18 lks.
- I-5 Sec. Cor. 10-11-14-15, bearings were: Tam 12", S43°E, 15 lks. & Spruce 6", N4°W, 9 lks.
- J-7 Quarter Cor. bet. Sec's. 14-23, bearings were: Cedar 8" for corner.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-7 Corner restored by Double Prop. Measure, from Corners; 1 mile South, 1 mile East, 1 mile North and 3 miles West. Found no evidence of original location.
- I-5 Re-placed corner in old road to North and East. Found iron bar in road intersection.
- J-7 Restored corner midway and on line bet. two Section corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners.


- I-7 Corner placed in pile of stone, New Bearings: 8" Oak, N1°W, 25.0' and 6" Oak, S38°W, 19.5' & 8" Oak, S20°E, 31.4'.
- I-5 No witnesses available.
- J-7 New Bearings: 16" W. Birch, S36°E, 25.7' & 8" S. Maple, S62°W, 12.0' & 8" Twin S. Maple, N19°W, 35.6'.

SIGNED BY

Billy D. Buckler  
Billy D. Buckler

DATE 9-21-79

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

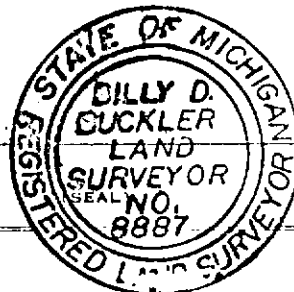

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_

DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_

DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_