

Chippewa Co.

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970
Chippewa Co. 4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 42 N. 26. S., R. 2 E. W.	K-9, L-9, J-9, K-8
2. PROPERTY CONTROLLING IN SECTION	, T. _____ N. S., R. _____ E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-14, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corners set by John Sullett, D.S. in 1845. Bearings were:

- K-9 Sec. Cor. 23-24-25-26, Cedar 12", S18°E, 20 lks. & Fir 12", S34°E, 11 lks.
- L-9 1/4 Cor. bet. Sec's. 24-25, Birch 12", S20°W, 12 lks. & Cedar 12", N43°E, 13 lks.
- J-9 1/4 Cor. bet. Sec's. 23-26, Fir 14", S31°W, 18 lks. & Cedar 6", N61°E, 12 lks.
- K-8 1/4 Cor. bet. Sec's. 23-24, Hemlock 8", N70°W, 7 lks. & Birch 14", S57°E, 16 lks.


- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- K-9 Re-established corner by Double Prop. Measure from corners; 1 mile North, 1 mile East, 1 mile West, and 2 miles South. Corner lies in Beaver pond, 75' North of high ground. Numerous Cedar stumps, but none could be identified as a witness.
 - L-9 Placed corner midway and on line bet. two Section corners. Found Cedar stumps, but none identified as a bearing tree.
 - K-8 restored corner midway and on line bet. two Sec. Cors. Corner lies 55' South of NE-SW, road.
 - J-9 Restored corner midway and on line bet. two Sec. Cors. Found no evidence of original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Placed 1" pipe with 4" aluminium cap at all corners. New Bearings are:

- K-9 8" Spruce, S39°E, 37.6' & 10" S. Maple, S7°W, 47.3' & 16" Balm-of-Gilead, S68°W, 21.8'.
- L-9 7" Cedar, N9°W, 31.5' & 7" Cedar, N86°E, 21.0' & 7" Cedar, S38°W, 17.0'. Corner lies in swamp.
- J-9 5" R. Pine, N31°E, 15.0' & 6" R. Pine, N29°W, 15.8' & 6" R. Pine, S35°W, 24.1'.
- K-8 7" Cedar, N58°E, 30.7' & 5" Cedar, N25°E, 2.5' & Twin 8" R. Maples, S65°W, 43.5'.

SIGNED BY Billy D. Buckler DATE 9-21-79
BILLY D. BUCKLER

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

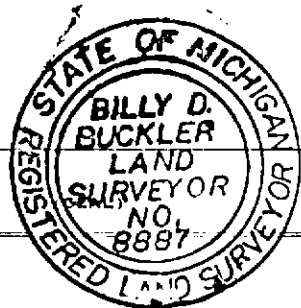

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____