

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Chippewa Co. 4 Corners.

| FOR CORNERS OF-- | LOCATED IN-- | CORNER CODE NUMBER |
|---|-----------------------------------|-----------------------|
| 1. PUBLIC LAND SURVEY_____ | T. <u>42</u> N. E. R. <u>2</u> E. | G-12, J-11, I-8, I-12 |
| 2. PROPERTY CONTROLLING IN SECTION_____ | T. _____ N. S. R. _____ E. W. | _____ |
| 3. MISCELLANEOUS PROPERTY IN SECTION_____ | T. _____ N. S. R. _____ E. W. | _____ |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9-19 & 10-26, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by John Mullett, D.S. in 1845. Bearings were:

- I-8 Quarter Corner bet. Sec's. 22-23. Sugar 10, N56°E, 9 lks. & Birch 10, S30°W, 9 lks.
- I-12 Quarter Corner bet. Sec's. 34-35. W. Birch 4, S88°W, 3 lks. & W. Birch 4, N86°E, 5 lks.
- G-12 Quarter Corner bet. Sec's. 33-34. Fir 10, S27°W, 7 lks. & W. Birch 8, N14°E, 8 lks.
- J-11 Quarter Corner bet. Sec's. 26-35. Cedar 12, for quarter section corner.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-8 Corner re-established midway and on line bet. two section corners.
- I-12 Corner re-established midway and on line bet. two section corners.
- G-12 Corner re-established midway and on line bet. two sec. cors. Found no evidence of original corner.
- J-11 Corner re-established midway and on line bet. two sec. corners. Found no features to fit on this mile.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Placed 1" pipe with 4" Aluminium cap at all corners. New Bearings:

- I-8 12" Red Maple, N23°W, 67.8' & 14" W. Birch, N79°W, 71.6' & 8" Red Maple, S7°E, 7.4'.
Corner lies 40' West of road.
- I-12 8" Red Maple, N69°W, 25.3' & 8" Red Maple, N23°E, 21.8' & Corner lies 40' North of road.
Pipe is placed in pile of stone.
- G-12 6" Cedar, S12°W, 53.7' & 8" W. Pine, S64°E, 104.7' & 8" W. Birch, S77°W, 8.8'.
- J-11 8" W. Birch, N18°W, 9.4' & 6" W. Birch, S26°W, 9.7' & 6" W. Birch, S62°E, 26.7'.

SIGNED BY _____ DATE 3-26-80

Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

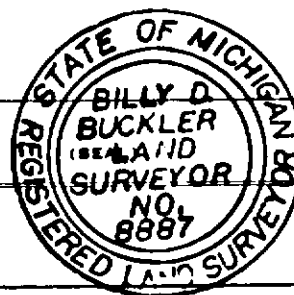

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____