

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

2 Corners

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> N. R. <u>2</u> E.	<u>C-9, H-11</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Euckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-6, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by John Mullett, D.S. in 1845. Bearings were:

- C-9 Sec. Cor. 19-20-29-30. Aspen 12", N43°W, 09 lks. & Spruce 6", S1°E, 07 lks.
- H-11 Quarter Cor. bet. Sec's. 27-34. Tamarack 8", N69°W, 13 lks. & Cedar 6", S71°E, 07 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-9 Corner re-established by prop. measure bet. corners; one mile North, one mile South, one mile West and three miles East. Corner lies 140.4' South and 261.5' West of an iron found in road. Found a dead Balsam with blazes on all four sides, 9.8' to South of cor.
- H-11 Corner replaced from both witnesses; Tam. is a 6' high stub with face and scribe marks complete. Bottom face grown over. Remains of Cedar with notch and face in poor condition. Found iron pipe, set by R. Larsen, to be 372.1' West and 114.4' North of this $\frac{1}{4}$ corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" Dep't cap at both corners. New Bearings:

- C-9 13" Cedar, N9°E, 16.0' & 13" Cedar, S37°E, 58.3' & 14" S. Maple, East, 50.0'.
- H-11 7" Cedar, N30°W, 14.1' & 9" Cedar, S17°W, 8.5' & 10" Cedar, N14°E, 25.2' & 12" Cedar, S73°E, 42.1'.

SIGNED BY Billy D. Euckler
 Billy D. Euckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 9-13-78

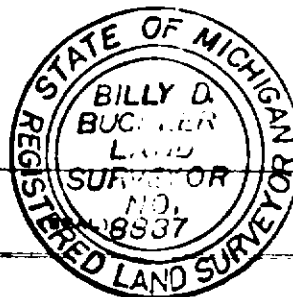

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____