

# LAND CORNER RECORDATION CERTIFICATE

**FILING REQUIREMENT OF ACT 74, MICH. P.A.1970**  
Chippewa Co. Drummond Is. 5 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>42</u> N. <del>X</del> , R. <u>6</u> E. <del>X</del>	<del>I-12</del> <del>J-12</del>
2. PROPERTY CONTROLLING IN SECTION <u>35</u>	T. <u>42</u> N. <del>X</del> , R. <u>6</u> E. <del>X</del>	<u>5-Sec.35</u> <u>6-Sec.35</u> <u>9-Sec.35</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____, R. _____ E. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 4-3, 4-4, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**


- I-12 Quarter Corner Bet. Sec's. 34-35.
- J-12 Center Corner, Section 35.
- 5-Sec.35 North 1/16 Corner, Sec. 35, T42N R6E.
- 6-Sec.35 NorthEast 1/16 Corner, Sec. 35, T42N R6E.
- 9-Sec.35 East 1/16 Corner, Sec. 35, T42N R6E.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- I-12 Re-established  $\frac{1}{4}$  Cor. midway and on line bet. two Sec. Cors. No evidence of original corner.
- J-12 Placed corner at intersection of lines connecting opposite  $\frac{1}{4}$  cors. Position checks close to old fences and clearings.
- 5-Sec.35 Placed corner midway bet. Center cor. and North  $\frac{1}{4}$  Corner.
- 6-Sec.35 Placed corner at intersection of lines, quartering the NE Quarter Section.
- 9-Sec.35 Placed corner midway bet. Center corner and East  $\frac{1}{4}$  Corner. Corner in line with old fence to West.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- Placed 1" pipe with 4" aluminium cap at all corners.
- I-12 New Bearings: 6" Hard Maple, S84°E, 33.5' and 20" Red Oak, N7°W, 16.1' and 8" Hard Maple, S49°W, 67.8'
  - J-12 Bearings: 12" Hard Maple, N45°W, 59.1' and 15" Hard Maple, N4°W, 51.5'
  - 5-Sec.35 Bearings: 10" Cedar, N88°W, 55.3' and 8" Maple, S9°E, 41.7'
  - 6-Sec.35 Bearings: 12" Beech, N74°W, 13.2' and 7" Iron Wood, S28°E, 11.9'
  - 9-Sec.35 Bearings: 9" Cedar, N80°E, 12.7' and 7" Cedar, S35°E, 4.0' and 9" Cedar, N21°W, 17.3'

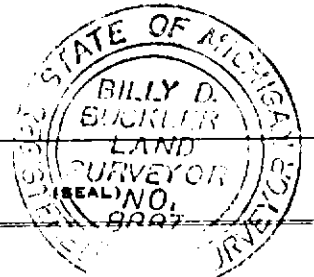

SIGNED BY Billy D. Buckler DATE 1/17/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_