

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
Chippewa

(County)	Located In:	Corner Code #
1. Public Land Survey	T <u>44N</u> R <u>6W</u>	<u>G11</u>
	T <u>44N</u> R <u>6W</u>	<u>L13</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Nov 08 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:


(G11) Corner common to Sections 27-28-33-34. Remonumented in 1973 and recorded in 1985 by Billy D. Buckler RLS. Set 1"x14" pipe on top of broken monument. Plat monument East 20.1', Plat monument North 90.1', Corner lies on east shoulder of road.  
 (L13) Corner common to Section 36 T44N-R06W and Section 1 T43N-R06W. 1963: Billy D. Buckler RLS reestablished the corner by single proportionate measurement along the township line. 1" pipe with 4" aluminum cap. 9" B.Spruce S32W 46 links, 11" J.Pine S45E 88 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G11) The 1973 monument was not recovered. Found the broken remains of the concrete monument referred to in the 1985 record, it being a 4" dia. concrete cylinder, now lacking iron, 12" below the surface of the gravel shoulder, at the Point of Commencement for Betcher's Second Plat in Section 27. The 1985 witnesses were recovered in good condition. Placed a 1"ID capped iron pipe at the position of the broken monument and at record distance from the 1985 witnesses.  
 (L13) Recovered the 1963 monument in good condition and at record bearing and distance from the remains of the 1963 NBTs. The J. Pine is a stump with scribing visible. The B.Spruce is a stump, cut low, with no marks visible. Left the monument in place and made new witnesses.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G11) Set 1"IDx8" iron pipe with plastic cap "MI DNR PS33986", top approx. 4" below gravel surface. Set measuring nails with tags in: 10" Tamarack N43W 67.35' 6" W.Birch S33E 25.3' The 1985 wits: 4"dia. concrete monument S84E 20.1' 4"dia. concrete monument N13E 90.1' Bearings are magnetic.	(L13) Fd. 1"ID iron pipe with 4" alum. State of Mich. cap. Blazed, scribed, and set measuring nails in: 6" Balsam S47W 42.5'      "1/4S NBT" 5" B.Spruce S41E 22.25'      do 5" B.Spruce N80E 10.7'      do 3" J.Pine N43E 32.1'      do Set cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.
--	---

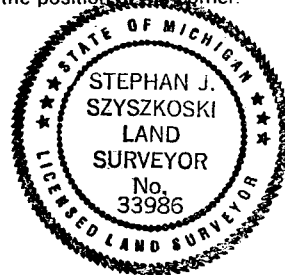

Signed by Stephan J. Szyszkoski Date 11/28/01  
 Surveyor's Michigan License No. 33986