

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>45</u> <sup>N.</sup> <del>X</del> , R. <u>1</u> <sup>W.</sup> <del>X</del>	<u>G-10, H-9</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____, <sup>N.</sup> S., R. _____, <sup>E.</sup> W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____, <sup>N.</sup> S., R. _____, <sup>E.</sup> W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-23, 5-18, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- G-10** Quarter Corner between Section's 27-28, set by James H. Mullett, D.S. in 1845. Bearings were: Sugar 12, S72°W, 49 lks. and Sugar 10, N15°E, 14 lks.
- H-9** Quarter Corner between Section's 22-27, set by James H. Mullett, D.S. in 1845. Bearings were: Hemlock 20, S45°W, 25 lks. and Birch 10, N25°E, 26 lks.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-10** Corner restored 33.0' West of a fence corner. This makes the half mile nearly equal. North = 2,666.4' South = 2,664.0'.
- H-9** Corner restored midway and on line between two Section Corners. Length of mile agrees with old Co. Surveyors records very well.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" aluminium at both corners.
- G-10** New Bearings: 24" Red Oak, S85°W, 59.2' and 24" Red Oak, S8°E, 11.9'. Corner lies 68' East of a trail road.
- H-9** New Bearings: 14" Hemlock, S88°E, 15.8' and 16" Hemlock, N41°E, 32.35' and 8" Hemlock, N60°W, 42.2'.

SIGNED BY Billy D. Buckler DATE 9-14-78  
**Billy D. Buckler**  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

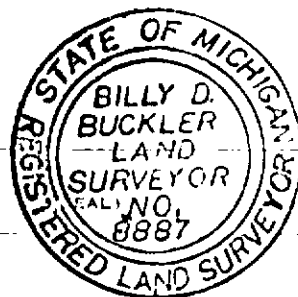

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_