

# LAND CORNER RECORDATION CERTIFICATE

**FILING REQUIREMENT OF ACT 74, MICH. P.A.1970**  
Chippewa Co. Two Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>45</u> N. R. <u>7</u> W.	I-4
2. PROPERTY CONTROLLING IN SECTION	<u>10</u> T. <u>45</u> N. R. <u>7</u> W.	7, Sec. 10
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 3-18 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
 I-4 Quarter Corner bet. Sections' 10-11, set by Wells Burt, D.S. in 1850.  
 Bearings were: Spruce 4", for Qr. Sec. Cor. and Spruce 6", S49° E, 10 lks.

7, Sec. 10 North 1/16 Corner, on East side, Sec. 10.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:  
 I-4 Replaced corner at an old wood post, set by unknown persons. Found very old line of blazes to North and South. Position checks well with corner 1/2 mile South.

7, Sec. 10 Corner placed midway and on line bet. Sec. Cor. to North and 1/4 Cor. to South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Placed 1" pipe with 4" aluminium cap at both corners.


I-4 New bearings: 5" Cedar, N27°W, 8.0' and 6" Cedar, S19°W, 6.5'

7, Sec. 10 New bearings: 10" Y. Birch, N50°E, 11.4' and 18" Hemlock, N5°W, 21.2'

SIGNED BY Billy D. Buckler

DATE 4-1-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

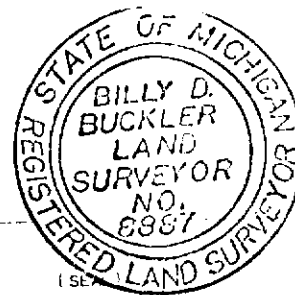

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ CHIEF OF SURVEY PARTY

DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ MICHIGAN REGISTERED LAND SURVEYOR

DATE \_\_\_\_\_

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_