

DEC 10 1999

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970
 Chippewa County Remonumentation Corner

For corners in

Chippewa SECTION Located In: Corner Code #

1. Public Land Survey
 SAME CORNER { T 47N R 1E M-1
 T 47N R 2E A-1
 T 48N R 1E M-13 ✓
 T 48N R 2E A-13

2. Property Controlling in Section S ___ T ___ R ___
 S ___ T ___ R ___

3. Miscellaneous Property in Sec. S ___ T ___ R ___
 S ___ T ___ R ___

\$7.00 LAND CORNER
 \$2.00 MSSR
 21 JAN 1999 11:10:35 AM Receipt #131
 RECEIVED FOR RECORD
 CHIPPEWA COUNTY - STATE OF MICHIGAN
 SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 10 PAGE 377
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Larry R. Rogers, in a field survey on 11/04/98, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(M-1) Northeast corner of Section 1, Township 47 North, Range 1 East, (Township Corner).

The original corner post was placed in October 1845 by John Mullett. Subsequent County Surveyor notes call for a concrete post. In 1981, Harry Goodwin reset corner 33 feet North of "wooden row stake at fence corner" and in line with fence to North. Testimony from local resident indicated concrete post at this position was washed out. Corner has since been used in numerous surveys.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

(M-1) Northeast corner of Section 1, Township 47 North, Range 1 East, (Township Corner).

Found Goodwin 1/2" iron pin 32.56 feet North of Goodwin right-of-way iron (recorded 33.0 feet). Corner position is consistent with recent surveys. Corner falls 5.5 feet South of centerline of East-West 2 track road. Accepted corner position as found and established four new witnesses.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(M-1) Northeast corner of Section 1, Township 47 North, Range 1 East, (Township Corner).

Corner is a 1/2" iron pin 5.5 feet South of the centerline of East-West 2 track road.

Witnesses:


1/2" Iron with cap #5434	South	32.56 feet
8" Spruce	N14°E	24.23 feet
4" Oak	N07°W	23.96 feet
12" Spruce	S44°W	12.69 feet
12" Spruce	S08°W	12.27 feet

Signed by _____ Date 30 Dec 1998

Surveyor's Michigan License No. 29251

NOTE: All bearings are compass bearings corrected for declination (6°W). All distances are to a nail and tag in the side of witness object unless otherwise noted.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995

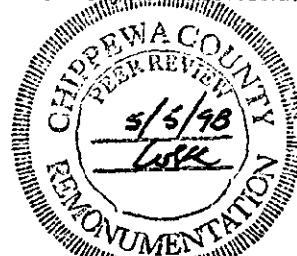

BOOK 10 PAGE 377