

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Chippewa Co.

5 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 49 N. 8., R. 6 E. W.	G-6, G-5 C-3, D-3
2. PROPERTY CONTROLLING IN SECTION 16	T. 49 N. 8., R. 6 E. W.	2-Sec. 16
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S., R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 11-13, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners placed by Wells Burt, D.S. in 1849.

G-6 $\frac{1}{4}$ Cor. bet. Sec's. 15-16. Bearings were: Y.Pine 10", S21°E, 35 lks. and W.Pine 12", N35°W, 27 lks.

G-5 Sec. Cor. 9-10-15-16. Bearings were: Y.Pine 12", N64°E, 45 lks. and W.Pine 18", S85°E, 50 lks.

C-3 Sec. Cor. 5-6-7-8. Bearings were: Y.Birch 14, N52°W, 34 lks. & Fir 8, S61°E, 28 lks.

D-3 $\frac{1}{4}$ Cor. Bet. 5-8. Bearings were: Spruce 8, N40°W, 10 lks. and hemlock 16, S70°E, 20 lks.

2-Sec.16 East 1/16 Corner, on Northside Section 16.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

G-6 Corner replaced from two original witnesses. Found remains of notch and scribe marks on both.

G-5 Corner re-established by proportionate measure, bet. corner $\frac{1}{2}$ mile South and 2 miles North. No evidence of original corner.

C-3 Corner re-established by proportionate measure, bet. corners, 2 miles East and $\frac{1}{2}$ mile West. No evidence of original corner.

D-3 Corner re-established midway and on line bet. two Sec. Cors.

2-Sec.16 Corner placed midway bet. Sec. Cor. to East and $\frac{1}{4}$ Cor. to West.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners.

G-6 New Bearings: 6" R. Pine, N53°W, 18.1' and 8" R. Pine, S48°W, 35.1'

G-5 New Bearings: 16" W. Pine, N26°W, 98.8' and 16" R. Pine, S51°W, 89.8'


C-3 New Bearings: 16" W. Pine, S4°E, 12.2' and 10" W. Pine, N73°E, 42.2'

D-3 New Bearings: 10" W. Pine, N68°E, 75.3' and 12" R. Pine, S4°W, 26.0'

2-Sec.16 Bearings: 6" J. Pine, N64°W, 6.8' and 6" J. Pine, S85°E, 03.2'

SIGNED BY Billy D. Buckler

DATE 12-17-75

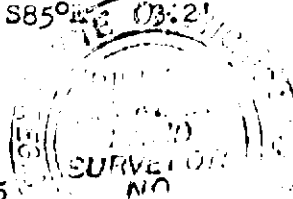

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____