

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

CHIPPEWA COUNTY

*3 corners.*

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>49</u> N. <u>6</u> W. <u>4</u> R. _____	E-3; E-2; F-3;
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, RLS, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 11/13/75, 19\_\_\_\_, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

**Corners set by Wells Burt, D.S. in 1849.**

E-3; Section Corner, 4-5-8-9. Bearings were:  
Y.Pine 20", N36W, 22 Lks, and W.Pine 15", S69E, 64 Lks.

E-2; Quarter Corner bet. Secs' 4-5. Bearings were:  
Fir 10", N27W, 29 Lks, and Fir 12", N2E, 15 Lks.

F-3; Quarter Corner bet. Secs' 4-9. Bearings were:  
W.Pine 12", N70W, 41 Lks. and Y.Pine, 12", S63E, 41 Lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

E-3; Corner re-established by Double Proportionate Measure, bet. Cors; 1 mile East; 1 1/2 miles West; 1 mile North and 1/2 mile South. Area badly burned, little evidence of Pine stumps remaining.

E-2; Cor. re-est. by S.P.M. and on line bet. two Sec. Cors'.

F-3; Cor. re-est. by S.P.M. and on line bet. two Sec. Cors'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

**Placed 1" Pipe with 4" Aluminum Cap, at all Corners.**

E-3; New Bearings:  
6" J.Pine, S20E, 11.8' and 12" J.Pine, S73W, 29.7'.

E-2; New Bearings:  
10" R.Maple, S7E, 21.9' and 8" R.Maple, N70W, 21.7'.

F-3; New Bearings:  
14" W.Pine, N36W, 83.5' and 6" J.Pine, S55E, 2.0'.


SIGNED BY Billy D. Buckler *Billy D. Buckler* DATE 9/28/76

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887.

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

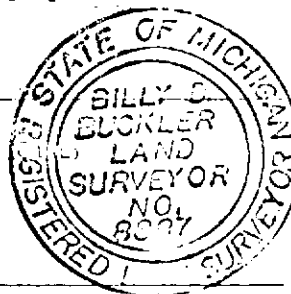

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_