

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970
Chippewa Co. Four Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>50</u> ^{N.} X. , R. <u>6</u> ^{X.} W.	G-8, G-6, D-5, E-4
2. PROPERTY CONTROLLING IN SECTION _____	T. _____, S. _____, R. _____, E. _____, W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____, S. _____, R. _____, E. _____, W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-24, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners placed by Wells Burt, D.S. in 1849.

G-8	¼ Cor. bet. Sec's. 21-22.	Bearings were:	Y. Pine 18, S44°W, 53 lks. and S. Pine 12, N69°E, 65 lks.
G-6	¼ Cor. bet. Sec's. 15-16.	Bearings were:	Y. Pine 20, S50°W, 80 lks. and Y. Pine 18, N45°E, 75 lks.
D-5	¼ Cor. bet. Sec's 8-17.	Bearings were:	Y. Pine 12, N53°E, 37 lks. and W. Pine 24, S67°E, 62 lks.
E-4	¼ Cor. bet. Sec's. 8-9.	Bearings were:	S. Pine 12, N87°W, 40 lks. and Spruce 10, N70°E, 50 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

G-8 Re-established corner midway and on line bet. two Sec. Cors. Found no evidence of original bearings.

G-6 Replaced corner from remains of two Y. Pine stumps in proper position for witnesses of record. Position checks well with good corners ½ mile south and 1 mile North.

D-5 Re-established corner midway and on line bet. Sec. Cor. to East and computed position of Sec. Cor. to West.

E-4 Re-established corner midway and on line bet. two Sec. Cors. Found no evidence of original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners.

G-8	New Bearings: 6" R. Pine, N35°E, 4.7' and 8" R. Pine, S10°W, 11.5'
G-6	New Bearings: 6" R. Pine, S36°E, 35.5' and 8" W. Pine, N60°E, 37.7'
D-5	New Bearings: 12" R. Pine, N6°W, 20.5' and 12" R. Pine, N80°W, 30.4'
E-4	New Bearings: 8" J. Pine, S61½°W, 9.4' and 6" J. Pine, S64°E, 18.9'

SIGNED BY Billy D. Buckler DATE 8-25-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

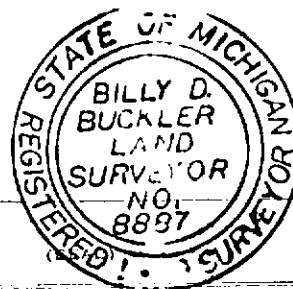

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____