

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Chippewa Co.

Six Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 50 ^{N.} X. , R. 6 ^{W.} X.	L-1, E-5, C-4
2. PROPERTY CONTROLLING IN SECTION	1, T. 50 ^{N.} X. , R. 6 ^{W.} X.	2-Sec.1 16-Sec.1 5-Sec.1
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____, ^{N.} _____, ^{S.} _____, R. _____, ^{E.} _____, ^{W.} _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-16, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

NOTE: SEE SKETCH ON BACK

- A. Description of original monument and accessories and/or subsequent restoration:
- L-1 Quarter Corner on Northside of Section 1, set by Austin Burt D.S. in 1849.
Bearings were: Pine 10", N57°W, 13 lks and Pine 10", N60°E, 1,76 Chs.
 - 2-Sec.1 East 1/16 Corner, on Northside, Section 1.
 - 16-Sec.1 East 1/16 Corner, on Southside, Section 1.
 - 5-Sec.1 North 1/16 Corner, Section 1.
 - E-5 Sec. Cor. common to 8-9-16-17, set by Wells Burt D.S. in 1849.
Bearings were: Y. Pine 18", S85°W, 51 lks. and Y. Pine 8", N71°E, 62 lks.
 - C-4 1/4 Cor. bet. Sec's. 7-8, set by Wells Burt D.S. in 1849.
Bearings were: S. Pine 8", S43°W, 49 lks. and S. Pine 12", N47°E, 54 lks.

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- L-1 Found 1" iron pipe at corner set by unknown Surveyor. Re-witnessed corner as found.
 - 2-Sec.1 Placed 1/16 Corner midway bet. Sec. Cor. to East and 1/4 Cor. to West.
 - 16-Sec.1 Placed 1/16 Corner midway bet. Sec. Cor. to East and 1/4 Cor. to West.
 - 5-Sec.1 Placed 1/16 Corner one quarter distance bet. the North 1/4 Cor. and the South 1/4 Cor.
 - E-5 Placed corner at an old squared Y. Pine stub. Found no original witnesses but did find blazes to North and South. Distance checks to marsh and top of hill.
 - C-4 Re-established corner midway bet. Sec. Cor. to North and computed location of Sec. Cor. to South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" aluminium cap at all corners.
- L-1 New Bearings: 12" W. Pine, S48°E, 46.5' and 12" W. Pine, S72°W, 42.2'
 - 2-Sec.1 Bearings: 8" W. Pine, S40°W, 37.5' and 6" R. Pine, S30°E, 35.7'
 - 16-Sec.1 Bearings: 20" W. Pine, S37°E, 28.9' and 12" W. Pine, N45°E, 45.3'
 - 5-Sec.1 Bearings: 6" W. Pine, N6°E, 21.2' and 8" W. Pine, S23°E, 26.7'
 - E-5 New Bearings: 6" J. Pine, S57°W, 17.4' and 6" J. Pine, S48°E, 26.9'
 - C-4 Placed 1" pipe with Brass Dep't cap.
New Bearings: 8" R. Pine, S64°W, 37.0' and 10" R. Pine, N88°E, 59.0'


SIGNED BY Billy D. Buckler DATE 8-25-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

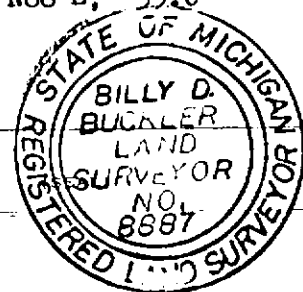

SURVEYOR'S MICHIGAN REGISTRATION NO. _____