

Chippewa Co.

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970  
Chippewa Co. 4 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____ T. 50 N. 7 E. W.	50 N. 7 E. W.	F-3, F-5, G-5
2. PROPERTY CONTROLLING IN SECTION- 9 T. 50 N. 7 E. W.	50 N. 7 E. W.	5-Sec. 9
3. MISCELLANEOUS PROPERTY IN SECTION_____ T. _____ N. S., R. _____ E. W.	N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-19-78 & 8-30, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
¼ and Sec. Cors. set by Wells Burt, D.S. in 1849.

- F-5 Quarter Corner bet. Sec's: 9-16, bearings were: Hemlock 24", S42°E, 34 lks. and Maple 6", N33°W, 08 lks.
- G-5 Sec. Cor. 9-10-15-16, bearings were: Spruce 10", S49°E, 12 lks. and Y. Birch 10", N37°W, 35 lks.
- F-3 Quarter Corner bet. Sec's: 4-9, bearings were: Hemlock 18", N20°E, 11 lks. and Fir 8", S10°W, 6 lks.
- 5-Sec.9 North 1/16 Corner of Section 9.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- F-5 Placed corner at 1" iron pipe with Hemlock stub marked with old blazes. Found two names on this stub; one is J. Cook, date indistinguishable. Corner lies 20' north of road.
- G-5 Found 2" iron pipe at corner. Checks well with other corners in area.
- F-3 Found 1" iron pipe at corner, with Hemlock stump in proper position.
- 5-Sec.9 Corner placed at computed position, midway bet. North ¼ cor. and the E-W ¼ line.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Placed 1" pipe with 4" aluminium cap at all corners.

- F-5 New Bearings: 14" W. Birch, N68°E, 26.7' and 6" Maple, N18°E, 18.8' and 14" Cedar, S11°E, 58.5'.
- G-5 New Bearings: 24" Y. Birch, N18°W, 12.7' and 6" Beech, N60°E, 35.1' and 8" Maple, S60°E, 32.6'.
- F-3 New Bearings: 18" Hemlock, N68°E, 12.9' and 20" Hemlock, S16°W, 40.9' and 18" S. Maple, S45°W, 28.5'. Corner lies on South side of steep hill.
- 5-Sec.9 Bearings: 8" S. Maple, N09°W, 11.0' and 10" S. Maple, N68°W, 15.0' and 10" S. Maple, S62°W, 31.8' and 1" Iron Pipe, S40°W, 19.2'.

SIGNED BY Billy D. Buckler DATE 9-10-79

Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

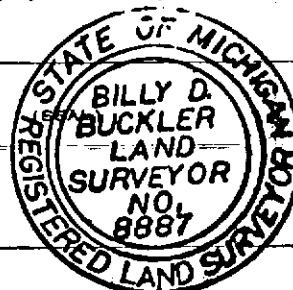

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_