

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Chippewa
(County)

Located In: _____ Corner Code # _____

1. Public Land Survey
T 50N R 7W I12
T 50N R 7W H11
T _____ R _____
T _____ R _____

2. Property Controlling
in Section S _____ T _____ R _____
S _____ T _____ R _____

3. Miscellaneous
Property in Sec. S _____ T _____ R _____
S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Oct 14 1996

I, Stephen J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(I12) Quarter corner common to Sections 34-35. Corner remonumented in 1974 by Billy D. Buckler. Corner replaced from one W. Pine bearing tree; a stub in poor condition, with calloused overgrowth showing outline of the face, notch and scribe marks. Found wood post bottom in proper position. Placed 1" pipe with 4" aluminum cap at corner. New Bearings: 7" Jack Pine S52W 72.2', 8" Jack Pine South 54.9'.

(H11) Quarter corner common to Sections 27-34. Corner remonumented in 1980 by Billy D. Buckler, ALS: "This corner was replaced from one Spruce Pine B.T. bearing N76W 13 links. Stub burned but in good condition. Corner monument 1" pipe with 4" brass cap placed and witnessed 9/8/80. Witnesses to corner 17" W. Pine N27W 22 links, 16" Red Pine N62E 57.5 links". Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I12) Recovered the 1974 monument as described, in good condition, and at record bearing and distance from the 1974 witness trees, both in good condition. Left the monument in place, marked new top blaze and set measuring nails in the 1974 trees, and marked two new accessories as described below. Corner recovered and rewitnessed by T. Stark and D. Lampela, Newberry District Office.

(H11) Recovered the 1980 monument as described, in good condition, and at record bearing and distance from the 1980 W. Pine witness, in good condition. The Red Pine has been windthrown. Left the monument in place, marked a new top blaze and set a measuring nail in the 1980 W. Pine, and marked three new bearing trees as described below. Corner recovered and rewitnessed by T. Stark and D. Lampela, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(I12) Found 1" pipe with 4" aluminum State of Michigan cap. Blazed, scribed, and set measuring nails in: 12" J. Pine S51W 72.6' "1/4S" 12" J. Pine S01W 55.2' "1/4S" 12" R. Pine N56E 78.3' "1/4S NBT" 14" J. Pine N74W 27.9' "1/4S NBT" Placed a squared and scribed cedar post adjacent. Bearings are magnetic.	(H11) Found 1" pipe with 4" brass MI Dept. of Conservation cap. Blazed, scribed, and set measuring nails in: 32" W. Pine N24W 15.05' "1/4S" 6" R. Pine S08W 32.45' "1/4S NBT" 8" R. Pine S76W 46.3' "1/4S NBT" 5" R. Pine N71E 48.6' "1/4S NBT" Found a 1" iron pipe alongside monument. Placed a scribed cedar post adjacent. Bearings are magnetic.
--	--

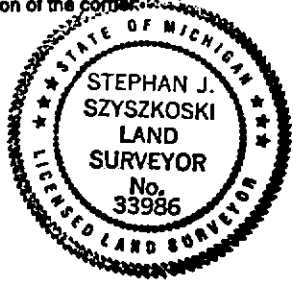

Signed by Stephen J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 2-13-97

For the Michigan Department of Natural Resources - Forest Management Division