

49

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Chippewa  
(County)

Located In:

Corner Code #

1. Public Land Survey

T\_\_\_ R\_\_\_  
T\_\_\_ R\_\_\_  
T\_\_\_ R\_\_\_  
T\_\_\_ R\_\_\_

2. Property Controlling  
In Section

S 27 T 50N R 7W     16  
S 35 T 50N R 7W     3

3. Miscellaneous  
Property in Sec.

S\_\_\_ T\_\_\_ R\_\_\_  
S\_\_\_ T\_\_\_ R\_\_\_

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Oct 14 1998

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(16-Sec. 27) East 1/16 corner between Sections 27-34. Corner not established in the original survey. Found no subsequent record.  
(3-Sec. 35) North 1/16 corner between Sections 34-35. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(16-Sec. 27) Found no monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Quarter corner 1321.51' West and Section corner 1321.51' East. At the position for the corner, I placed a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner monumented, I found a 1" ID iron pipe, 29.0' North, and 3.3' West. Corner placed and witnessed by T.Stark and D.Lampela, Newberry District Office.  
(3-Sec. 35) Found no monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Quarter corner 1323.22' south and Section corner 1323.22' north. At the position for the corner, I placed a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner monumented, I found a 1" ID iron pipe, 9.4' south, and 5.0' west. Corner placed and witnessed by T.Stark and D.Lampela, Newberry District Office. A SW-NE trail road lies approximately 90 ft. north of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(16) Set 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following: 8" W. Pine N69W 37.9'     "E1/16 BT" 3" J. Pine S25W 36.5'     "E1/16 BT" 6" W. Pine S47W 55.3'     "E1/16 BT" 4" J. Pine N04W 21.4'     "E1/16 BT" Found 1" pipe N02W 29.05' Placed a squared and scribed cedar post adjacent. Bearings magnetic.	(3) Set 1" pipe with 4" MDNR cap. Blazed, scribed and set measuring nails in the following: 12" J. Pine S75W 12.55'     "N1/16 BT" 6" J. Pine N35E 6.75'     "N1/16 BT" 10" J. Pine S50E 8.0'     "N1/16 BT" 10" J. Pine S10W 7.15'     "N1/16 BT" Found 1" pipe S31W 10.5' Placed a squared and scribed cedar post adjacent. Bearings are magnetic.
---	---

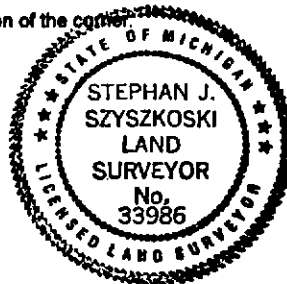

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 2-13-97

For the Michigan Department of Natural Resources - Forest Management Division