

48

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Chippewa

(County)

Located In:

Corner Code #

1. Public Land Survey

T 50N R 7W I11

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Oct 14 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


(I11) Corner common to Sections 26-27-34-35. Corner established in 1849 by Wells Burt: "Set spruce post corner of sections 26, 27, 34, & 35. Spruce 12 S10E 14, do 7 N49W 43." The 1849 notes show line trees at the following locations: Y. Pine 14, 2.74 ch. South; Spruce 12, 2.46 ch. East; W. Pine 10, 6.01 ch. West. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I11) The original post and accessories were not recovered. The line trees noted above were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner by Double Proportionate Measurement to the original record between perpetuated original quarter corners 2646.66 ft. North, 2636.45 ft. East, 2646.44 ft. South, and 2643.02' West. At the position for the corner, I placed a 1" I.D x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the corner monumented, I recovered a 1" iron pipe, placed by an unknown party (perhaps long ago by Combined Locks Co.), nearly 22' distant. Similar pipes were recovered near the 1/16 corners west and south of here. My measurements between all of these pipes indicate that one or more of them were either carelessly placed or subsequently moved from position. And, as no other substantiating evidence was found, I was reluctant to place too great a weight on the position of the pipe found at this location, and did not accept it as marking the position of the Section Corner. Corner monumented and witnessed by T.Stark and D.Lampela, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(I11) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following:
10" J. Pine S01W 11.3' "S34 NBT"
12" J. Pine N66E 7.35' "S26 NBT"
8" J. Pine N20W 8.45' "S27 NBT"
6" J. Pine S25E 19.15' "S35 NBT"
Found 1" pipe S61W 21.9'
Placed a squared and scribed cedar post
adjacent. Bearings are magnetic.

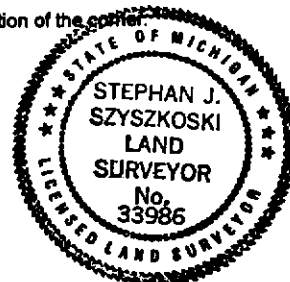

Signed by

Stephan J. Szyszkoski

Date

2-13-97

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division