

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 32 N. R. 5 W.	F-9; G-9; G-10
2. PROPERTY CONTROLLING IN SECTION 28	T. 32 N. R. 5 W.	1; 7
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 20, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~As a description of original monument and accessories and/or accessories used in restoring or re-establishing corner:~~  
 C. (continued)

Set 1 1/4"x36" pipe over fd. RR iron	1	Drove 1 1/4"x24" Iron Rod
Corner Fn. Post w/loc. tag		9" Cedar S60°W 36.4
S07°W 30.7		9" Cedar N74°W 37.4
Power Pole N19°W 38.08		6" Cedar S74°E 40.6
8" Basswood S42°E 42.56		Fd. 1/2" sq. spk. N01°W 11.75
8" Twin Domestic Cherry		Set cedar post w/loc. tag Due E 33'
S36°W 34.0		Fd. 3/8" pipe N35°W 1.45

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- F-9 Found 1/2" pipe in road intersection E-W-N and fence to south.
  - G-9 Recovered old rotted 3/4" pipe & 4" ced. stk. bottom that fits survey of E line of Sec. 28 by Robinson in 1906 & fits line & dist. across 1/8 corner & 1/2 corner to W very close. Found & removed newer looking 3/4" pipe that corner falls in "T" rd. intersection in line with center of gravel road S and three ft. south of center of E-W gravel road.
  - G-10 Reestablished corner per std. B.L.M. instructions which fits Robinson survey on E line of Sec. 28. Corner falls in approximate center of N-S gravel road.
  - 1 Recovered narrow gauge RR iron, 3.5' deep, in E-W road fill.
  - 7 Established corner per standard B.L.M. instructions. Corner falls in center of N-S gravel road.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-9	G-9	G-10
Fd. 1/2" pipe & added 1 1/4"x24" pipe	Fd. stk. & iron & set 1 1/4"x22" iron rod	Set 1 1/4"x22" Iron Rod
18" W. Pine N38°W 51.10	Power Pole N47°E 52.27	Power Pole N68°E 37.63
Power Pole N61°E 63.63	12" Tamarack N23°E 59.45	12" Cedar N59°W 35.2
22" Apple S33°W 30.59	8" Tamarack S63°E 90.82	12" Cedar S65°W 52.0
Cedar post w/loc. tag	6" Tamarack S48°W 80.05	Set cedar post w/loc. tag
Due S 33'	Set cedar post w/loc. tag	Due E 33'
	Due N 31.6	


SIGNED BY Carl F. Roser 4-26-76 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

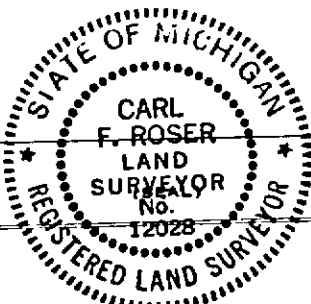

BOYNE VALLEY TOWNSHIP  
CHARLEVOIX COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_