

DEC 07 1993

COMMISSIONER

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Approved By Delta County
Land Survey Remonumentation
Peer Group Under Act 345 Of
P.A. Of 1990 On ~~December 30~~, 1993

Robert B. Ameling
Acting Chairman

DELTA COUNTY

For corners in
DELTA
(County)

Located In: Corner Code #

- | | | |
|------------------------------------|---------------|----------|
| 1. Public Land Survey | T 39 N R 23 W | C-9 C-10 |
| | T R | |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |

LIBER 7 PAGE 343

93 DEC -2 AM 9:00

Walter C. Hosmer
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims C-9 [NW COR SEC 29] C-10 [1/4 COR COMMON TO SEC'S 30/29]

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						

I, M.P. DAVIS, in a field survey on MAY, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


C-9 [NW COR SEC 29] WOOD POST-1846-A.MERRYWEATHER D.S. - (HEMLOCK 18°-S70°E-18 LINKS) (HEMLOCK 24°-N40°W-25 LINKS)
M.S. McNABB - 1914 - RESET BY MEASUREMENT TO ADJOINING COR'S - BT STAKES NW & SE 33'

C-10 [1/4 COR COMMON TO SEC'S 30/29] WOOD POST-1846-A.MERRYWEATHER D.S. - (BIRCH 18°-S49°E-13 LINKS) (HEMLOCK 18°-N70°W-20 LINKS)
M.S. McNABB - 1914 - FOUND STAKE & OLD BT IN PLACE - FENCE POST S42°E-28' -- CEDAR STAKE NW 33'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-9 [NW COR SEC 29] FOUND IRON PIPE IN PLACE AS INDICATED BY ROAD IMPROVEMENTS & OCCUPATION - NO EVIDENCE OF McNABB'S BT STAKES
DISTANCES TO OTHER CORNERS COMPARES WELL WITH McNABB'S RECORDS
ACCEPTED EXISTING MONUMENT AS A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER

C-10 [1/4 COR COMMON TO SEC'S 30/29] FOUND 1/2" IRON PIN IN PLACE AS INDICATED BY ROAD IMPROVEMENTS N-S & E & OCCUPATION WEST
DISTANCES TO OTHER CORNERS COMPARES WELL WITH McNABB'S RECORDS
ACCEPTED EXISTING MONUMENT AS A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER

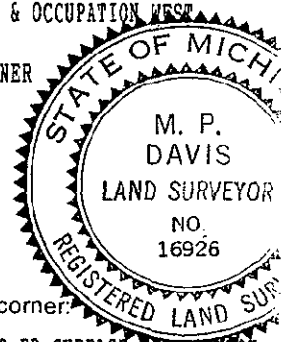

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-9 SET, OVER EXISTING MONUMENT, A 5/8" X 18" REBAR W/A ALUMN CAP STAMPED TO ID THE COR POSITION & RAISED TO RD SURFACE W/A MON BOX
CEDAR 6" SPRUCE 6" SPRUCE 5" TAMARACK 14" SURVEY MONUMENT SIGN POST
N25°W N42°E S36°E S77°W EAST
69.95' 71.95' 55.16' 59.53' 24.92' (TO FACE)

C-10 SET, OVER EXISTING MONUMENT, A 5/8" X 18" REBAR W/A ALUMN CAP STAMPED TO ID THE COR POSITION & RAISED TO RD SURFACE W/A MON BOX
TWIN RED PINE POWER POLE ELM 6" SURVEY MONUMENT SIGN POST
N62°W S44°E S62°W N47°E
37.34' 47.67' (TO FACE) 38.06' 53.42' (TO FACE)

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC & DISTANCES ARE TO A NAIL IN THE CENTER OF THE OBJECT UNLESS NOTED OTHERWISE

Signed by M.P. Davis Date 11/15/93

Surveyor's Michigan License No. 16926