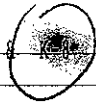


*Robert Schumeling*  
Chairman

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>DELTA</u> (County)	Located In:	Corner Code <u>##</u>
1. Public Land Survey	T <u>39</u> N R <u>23</u> W	<u>K-6</u> 
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

MAY 13 1994

Recorded \_\_\_\_\_  
at 9:00 o'clock AM in Liber 7 Page 390  
*William C. Thoren* Reg. of Deeds.  
Delta County, Michigan  
Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_  
K-6 [1/4 COR COMMON TO SEC'S 14/13] K-8 [1/4 COR COMMON TO SEC'S 23/24]

I, M. P. DAVIS, in a field survey on MARCH, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	V
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- K-6 [W1/4 COR SEC 13] WOOD POST-1846-A. MERRYWEATHER D.S. (TAMERAC 04°-N39°E-10 LINKS) (TAMERAC 08°-S69°W-29 LINKS)  
PRIVATE RECORDS OF M.S. McNABB DATED APRIL 1938 INDICATE WOOD POST FOUND IN PLACE BY "MASON" FOR THE ROAD COMMISSION NO WIT'S NOTED.  
CITY OF ESCANABA ENGINEER'S RECORDS INDICATE AN IRON PIPE IN PLACE - NO WIT'S NOTED
- K-8 [W1/4 COR SEC 24] WOOD POST-1846-A. MERRYWEATHER, D.S. (TAMERAC 03°-N71°E-15 LINKS) (CEDAR 06°-S55°W-15 LINKS)  
M.S. McNABB - 1915 - FOUND WOOD STAKE IN PLACE & REPLACED W/A IRON PIPE (NEW BT NOTED - SPRUCE 6°-S25°E-20')  
CITY OF ESCANABA ENGINEER'S RECORDS INDICATES IRON PIPE IN PLACE - NO WIT'S NOTED

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- K-6 [W1/4 COR SEC 13] FOUND IRON PIPE & ROTTED REMAINS OF WOOD POST - DISTANCES TO COR'S N-S & E COMPARE WELL WITH THE CITY ENGINEER'S RECORDS. ACCEPTED EXISTING MONUMENT AS A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.
- K-8 [W1/4 COR SEC 24] FOUND 1/2" X 48" REBAR ENCASED IN A 4" X 4" X 48" CONCRETE MONUMENT - DISTANCES N-S & E COMPARE WELL WITH THE CITY ENGINEER'S RECORDS. ACCEPTED EXISTING MONUMENT AS A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- K-6 SET OVER EXISTING I.P. A BERNTSEN A1NB30 ALUMN MON WITH THE CAP STAMPED TO ID THE CORNER POSITION.  
TAMERACK 06° SURVEY MONUMENT SIGN POST NOTE: COR POSITION IS IN A DENSE TAG ALDER SWAMP  
S61°W S45°E NO OTHER WIT'S ARE AVAILABLE  
51.50' 3.0' (TO FACE)
- K-8 DID NOT DISTURB EXISTING MONUMENT  
CEDAR 9° CEDAR 6° CEDAR 6° CEDAR 5° SURVEY MONUMENT SIGN POST  
N32°W N45°E S12°E S69°W S.15°W  
39.60' 75.16' 29.69' 14.49' 2.18' (TO FACE)

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC & DISTANCES ARE TO A NAIL W/A REFERENCE TAG, UNLESS NOTED OTHERWISE

Signed by M.P. Davis Date 4/30/94  
Surveyor's Michigan License No. 16926